

# Inspection and Testing Certificate

Presented To

CGL Companies

For

Charles B. Webster Detention Center building

1941 Phinizy Road  
Augusta, Georgia 30906  
United States

This site has been inspected and tested in compliance with applicable standards.

Completed  
Friday, June 13, 2025

Test Session :ANNUAL FIRE INSPECTION 2025

ACCEPTED BY

CGL Companies  
1903 Phoenix Boulevard  
Atlanta, Georgia 30349  
United States

TESTED BY

Christopher Kirkbride  
Basesix Systems  
2053 Franklin Way  
Marietta, GA 30067  
United States

INSPECTION STATUS

**Attention needed**

One or more Deficiencies have been identified, system may respond if needed



# Inspection Summary

## Building Information

PROPERTY	Charles B. Webster Detention Center building	CONTACT
ADDRESS	1941 Phinizy Road	PHONE
CITY/STATE/ZIP	Augusta, Georgia 30906	MOBILE
COUNTRY	United States	EMAIL

## Inspector Information

COMPANY	Basesix Systems	CONTACT	Christopher Kirkbride
ADDRESS	2053 Franklin Way Marietta, GA 30067	LICENSE NUMBER	Nicet Certification # 148593
COUNTRY	United States	PHONE	+1 470-590-2691
		EMAIL	ckirkbride@basesix.com


## Testing Summary

EQUIPMENT TYPE	TOTAL	TESTED	PASSED	FAILED
Initiating Device	678	677(100%)	345(51%)	332(49%)
Emergency Control Equipment	51	50(98%)	34(67%)	16(31%)
Power Supplies	13	13(100%)	11(85%)	2(15%)
Emergency Communication Equipment	1	1(100%)	1(100%)	0(0%)
Supervising Station Transmitting Equipment	1	1(100%)	0(0%)	1(100%)
Fire Control Panel	10	10(100%)	5(50%)	5(50%)

## Certification

The equipment specified herein was inspected and tested according to the NFPA 72 standard for fire alarm and signaling systems, with the inspection completed on Friday, June 13, 2025

ACCEPTED BY      06/13/2025  
  
Building Representative

  
TESTED BY      06/13/2025  
Christopher Kirkbride  
Technician

# System Details

## Control Units

ADDRESS / SCAN ADDRESS	N5	DESCRIPTION	Sub FACP panel in I pod
MANUFACTURER	NOTIFIER	S/W VERSION	
MODEL	NFS 320	LAST UPDATE	
SERIAL NUMBER		S/W LOCATION	
INSTALL DATE	04/08/2025		

ADDRESS / SCAN ADDRESS	N1	DESCRIPTION	main FACP in main telco room
MANUFACTURER	NOTIFIER	S/W VERSION	
MODEL	NFS 3030	LAST UPDATE	
SERIAL NUMBER		S/W LOCATION	
INSTALL DATE	04/08/2025		

## Secondary Power

TYPE	Battery - Sealed Lead-acid	DESCRIPTION	Sub FACP panel in I pod battery 2
ADDRESS / SCAN ADDRESS		NOMINAL VOLTAGE	
LOAD VOLTAGE		AMP HOURS	55
STANDBY HOURS	24	ALARM MINUTES	15
BATTERY LOCATION	Below panel	CHARGER VOLTAGE	
TYPE	Battery - Sealed Lead-acid	DESCRIPTION	
ADDRESS / SCAN ADDRESS	Main FACP Battery #2	NOMINAL VOLTAGE	12
LOAD VOLTAGE		AMP HOURS	55
STANDBY HOURS		ALARM MINUTES	
BATTERY LOCATION		CHARGER VOLTAGE	
TYPE	Battery - Sealed Lead-acid	DESCRIPTION	
ADDRESS / SCAN ADDRESS	Main FACP Battery #1	NOMINAL VOLTAGE	12
LOAD VOLTAGE		AMP HOURS	55
STANDBY HOURS		ALARM MINUTES	
BATTERY LOCATION		CHARGER VOLTAGE	
TYPE	Battery - Sealed Lead-acid	DESCRIPTION	BATTERY#1
ADDRESS / SCAN ADDRESS	ELECTRICAL RM POWER SUPPLY BY G POD	NOMINAL VOLTAGE	12
LOAD VOLTAGE		AMP HOURS	7
STANDBY HOURS		ALARM MINUTES	
BATTERY LOCATION		CHARGER VOLTAGE	
TYPE	Battery - Sealed Lead-acid	DESCRIPTION	BATTERY#2
ADDRESS / SCAN ADDRESS	ELECTRICAL RM POWER SUPPLY BY G POD	NOMINAL VOLTAGE	12
LOAD VOLTAGE		AMP HOURS	7
STANDBY HOURS		ALARM MINUTES	
BATTERY LOCATION		CHARGER VOLTAGE	
TYPE	Battery - Sealed Lead-acid	DESCRIPTION	IT ROOM ON FC CORRIDOR
ADDRESS / SCAN ADDRESS	POWER SUPPLY BATTERY #1	NOMINAL VOLTAGE	12

LOAD VOLTAGE		AMP HOURS	7
STANDBY HOURS		ALARM MINUTES	
BATTERY LOCATION		CHARGER VOLTAGE	
TYPE	Battery - Sealed Lead-acid	DESCRIPTION	IT ROOM ON FC CORRIDOR
ADDRESS / SCAN ADDRESS	POWER SUPPLY BATTERY #2	NOMINAL VOLTAGE	12
LOAD VOLTAGE		AMP HOURS	7
STANDBY HOURS		ALARM MINUTES	
BATTERY LOCATION		CHARGER VOLTAGE	
TYPE	Battery - Sealed Lead-acid	DESCRIPTION	IT ROOM ON FC CORRIDOR
ADDRESS / SCAN ADDRESS	POWER SUPPLY BATTERY#2	NOMINAL VOLTAGE	12
LOAD VOLTAGE		AMP HOURS	7
STANDBY HOURS		ALARM MINUTES	
BATTERY LOCATION		CHARGER VOLTAGE	
TYPE	Battery - Sealed Lead-acid	DESCRIPTION	IT ROOM ON FC CORRIDOR
ADDRESS / SCAN ADDRESS	POWER SUPPLY BATTERY #1	NOMINAL VOLTAGE	12
LOAD VOLTAGE		AMP HOURS	7
STANDBY HOURS		ALARM MINUTES	
BATTERY LOCATION		CHARGER VOLTAGE	
TYPE	Battery - Sealed Lead-acid	DESCRIPTION	Sub FACP panel in I pod battery 1
ADDRESS / SCAN ADDRESS		NOMINAL VOLTAGE	
LOAD VOLTAGE		AMP HOURS	55
STANDBY HOURS	24	ALARM MINUTES	15
BATTERY LOCATION	Below panel	CHARGER VOLTAGE	

## Monitoring Information

DIALER next to FACP			
TYPE	Digital Alarm Communicator Transmitter	INSTALL DATE	06/12/2025
MANUFACTURER	Notifier	TEST START	06/09/2025
MODEL	911A	TEST COMPLETE	06/27/2025
SERIAL NUMBER		Time to Transmit to Supervising Station	
MONITORING ORGANIZATION	N/A	ALARM SIGNAL	—
MONITORING ORGANIZATION PHONE	N/A	ALARM RESTORE	—
MONITORING ORGANIZATION EMAIL	N/A	TROUBLE SIGNAL	—
MONITORING ORGANIZATION ACCOUNT NUMBER	N/a	TROUBLE RESTORE	—
MONITORING PHONE LINE 1	N/A	SUPERVISORY SIGNAL	—
MONITORING PHONE LINE 2	N/A	SUPERVISORY RESTORE	—
MONITORING RETRANSMISSION ENTITY	Fire department		

# Open Corrective Action & Solution Summary

The following 762 corrective action(s) remain open following the system inspection, testing or maintenance activities

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L05D012	Mechanical rm E085
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to mechanical rm E085
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D013	Mechanical rm E085
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to mechanical rm E085
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D021	Mechanical rm 058
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to mechanical rm 058
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D068	Mechanical rm 058
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to mechanical rm 058
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D009	File storage rm E113
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to file storage rm E113
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D010	Admin Area Over Resceptionist Desk
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to Admin area over receptionist desk
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
[Other]	N001 L05M009	Jail Admin Lobby
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to jail admin lobby
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L04D054	janitors closet P082 smoke
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to janitors closet P082 smoke
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D091	POD D COMMON AREA
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to POD D COMMON AREA
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D098	Lobby Corridor Smoke
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to lobby corridor smoke
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D099	Lobby Corridor
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to lobby corridor
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D092	Corridor Outside Kitchen
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to corridor outside kitchen
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D093	Corridor Outside Kitchen
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to corridor outside kitchen
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D094	Corridor Outside Dining Hall
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description in panel to corridor outside dining hall
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Heat Detector - Restorable Spot	N001 L04D018	Kitchen
	Created By:	Chase Buchanan

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/09/2025
	Corrective Action:	Change description to kitchen heat
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	FST-851
Heat Detector - Restorable Spot	N001 L04D019	Kitchen
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to kitchen heat
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	FST-851
Smoke Detector - General	N001 L04D001	hazardous Chem storage kitchen
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description on panel to hazardous Chem storage kitchen
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D003	kitchen storage
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description on panel to kitchen storage
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Heat Detector - Restorable Spot	N001 L04D004	Kitchen
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to kitchen heat
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	FST-851
Heat Detector - Restorable Spot	N001 L04D007	Kitchen
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to kitchen heat
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	FST-851
Smoke Detector - General	N001 L04D097	Armory
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description on panel to armory
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D098	Sargents Office
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to sargents office
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Manual Fire Box	N001 L04M003	Staff D hall
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change description to staff dining hall  NOTIFIER NBG12LX
Smoke Detector - General	N001 L01D013	2nd floor corridor at smoke doors
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name to 2nd fl corridor at smoke doors  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D051	Mechanical room a 245
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name to Mechanical rm A245  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D052	Mechanical room a 245
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name to Mechanical rm A245  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D053	Mechanical room a 245
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name to Mechanical rm A245  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D054	Mechanical room a 245
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name to Mechanical rm A245  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D064	Outside visitation a
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name to outside visitation A  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L01D065	2nd floor corridor
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name to 2nd fl corridor
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D066	2nd floor corridor
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name to 2nd fl corridor
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D067	2nd floor corridor
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name to 2nd fl corridor
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D069	2nd floor corridor
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name to 2nd fl corridor
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D070	2nd fl elevator lobby
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to 2nd fl elevator lobby
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D071	2nd floor corridor outside visitation B
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name to 2nd fl corridor outside visitation B
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D072	2nd floor corridor
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name to 2nd fl corridor
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D073	2nd fl corridor
	Created By:	Chase Buchanan

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to 2nd fl corridor
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D074	2nd fl corridor
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to 2nd fl corridor
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D075	2nd fl corridor
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to 2nd fl corridor
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D079	2nd fl corridor
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to 2nd fl corridor
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D080	2nd fl sprinkler closet
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to 2nd fl sprinkler closet
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D081	2nd fl corridor
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to 2nd fl corridor
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D083	2nd fl corridor at smoke doors
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name to 2nd fl corridor at smoke doors
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D085	2nd fl corridor at smoke doors
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to 2nd fl corridor at smoke doors
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D086	2nd floor corridor at smoke doors
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name to 2nd fl corridor at smoke doors  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D089	2nd floor IT room
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name to 2nd fl IT rm  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D090	2nd fl corridor Area E
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name on panel to 2nd fl corridor area E  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D097	1st fl elevator lobby
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name on panel to 1st fl elevator lobby  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D011	laundry smoke
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name on panel to laundry smoke  NOTIFIER SDX-551, FSP-851, FSP-951IV
Heat Detector - Restorable Spot	N001 L04D013	Detector L04D013
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name to laundry heat  NOTIFIER FST-851
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Device needs to be remounted  NOTIFIER FST-851

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Heat Detector - Restorable Spot	N001 L04D014	Detector L04D014
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name to laundry heat above dryers and needs to be remounted
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	FST-851
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Needs to be remounted
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	FST-851
Smoke Detector - General	N001 L04D015	JANITOR LAUNDRY
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name in panel to JANITOR LAUNDRY
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D021	WAREHOUSE
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name to warehouse
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D022	WAREHOUSE
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to warehouse
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D023	WAREHOUSE
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to warehouse
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D024	WAREHOUSE
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to warehouse
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D026	WAREHOUSE
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to warehouse

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Proposed Solution: Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Heat Detector - Restorable Spot	N001 L04D027	CENTRAL PLANT
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device address in panel to CENTRAL PLANT  NOTIFIER FST-851
Heat Detector - Restorable Spot	N001 L04D028	CENTRAL PLANT
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device address in panel to CENTRAL PLANT  NOTIFIER FST-851
Heat Detector - Restorable Spot	N001 L04D029	CENTRAL PLANT
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device address in panel to CENTRAL PLANT  NOTIFIER FST-851
Heat Detector - Restorable Spot	N001 L04D030	CENTRAL PLANT
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device address in panel to CENTRAL PLANT  NOTIFIER FST-851
Smoke Detector - General	N001 L04D043	COMMON AREA POD D
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change address in panel to COMMON AREA POD D  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D044	COMMON AREA POD D
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change address in panel to COMMON AREA POD D  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D002	BOOKING I POD
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change description of device in panel to BOOKING I POD  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L05D003	mechanical rm E088
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to duct mechanical rm E088
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D005	BOOKING I POD
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description of device in panel to BOOKING I POD
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D006	mechanical rm E088
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to duct mechanical rm E088
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D022	mechanical rm E088
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to mechanical rm E088
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Elevator Recall - Alternate	N001 L05M002	Elevator alternate recall
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name to elevator alternate recall
	Proposed Solution:	
	Manufacturer:	
	Model:	
Elevator Recall - Primary	N001 L05M003	Primary elevator recall
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name to elevator primary recall
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L05M005	ADMIN HEARING RM
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change device name on panel to ADMIN HEARING RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
[Other]	N001 L01M008	Outside visitation a

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name to outside visitation A  NOTIFIER NBG12LX
[Other]	N001 L01M009	Mechanical room a 245
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name to Mechanical rm A245  NOTIFIER NBG12LX
[Other]	N001 L01M015	2nd fl elevator lobby
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name on panel to 2nd fl elevator lobby  NOTIFIER NBG12LX
[Other]	N001 L01M031	Central control
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name to central control  NOTIFIER NBG12LX
Smoke Detector - General	N001 L02D053	Mechanical room B246
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name to Mechanical rm B246 2nd fl  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D062	CENTRAL HALL CORRIDOR
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name on panel to CENTRAL HALL CORRIDOR  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D002	kitchen storage smoke
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/09/2025 Change device name on panel to kitchen storage smoke  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D005	Loading Dock Storage
	Created By: Creation Date: Corrective Action:	Chase Buchanan 06/09/2025 Change device name on panel to loading dock storage smoke

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Proposed Solution: Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Fan Control	N001 L02M001	Pod B fan control
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device description to POD B FAN CONTROL
[Other]	N001 L02M006	POD B TOWER PULL STATION
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device description to POD B TOWER PULL STATION NOTIFIER NBG12LX
Fan Control	N001 L01M001	Pod A Fan Control
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device description in panel to control relay Pod A Fan Control
Door Control Relay	N001 L01M002 L01M002	Pod A Door Release
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device description in panel to control relay Pod A Door Release
[Other]	N001 L01M012	MECHANICAL RM POD B
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device description on panel to MECHANICAL RM POD B NOTIFIER NBG12LX
[Other]	N001 L01M091	Module L01M091
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device description to HORN STROBES PODS
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/12/2025 The FACP is showing open circuit

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
[Other]	N001 L01M092	Module L01M092
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description to HORN STROBES POD G
	Proposed Solution:	
	Manufacturer:	
	Model:	
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	The FACP is showing an open circuit
	Proposed Solution:	
	Manufacturer:	
	Model:	
HVAC Shutdown	N001 L01M093	Pod D shut down
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description to POD D SHUTDOWN
	Proposed Solution:	
	Manufacturer:	
	Model:	
Fan Control	N001 L01M094	Pod D fan control
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description to POD D FAN CONTROL
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L01M095	Module L01M095
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L01M096	Module L01M096
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	
	Model:	
Door Holder Release	N001 L01M099	DOOR RELEASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description to DOOR HOLDERS
	Proposed Solution:	
	Manufacturer:	
	Model:	
Fan Control	N001 L03M002	Pod C fan control
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description to POD C FAN CONTROL

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Proposed Solution: Manufacturer: Model:	
Door Holder Release	N001 L03M003	POD C DOOR RELEASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device description to POD C DOOR RELEASE
[Other]	N001 L03M004	CONTROL TOWER POD C
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device description to CONTROL TOWER POD C  NOTIFIER NBG12LX
[Other]	N001 L04M007	Module L04M007
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Device could not be located based off description
[Other]	N001 L01M097	Module L01M097
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Device could not be located based off description
[Other]	N001 L01M098	Module L01M098
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Device could not be located based off description
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L05M014	Mechanical room E058
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description and panel needs to be changed to mechanical room E085
Supervisory - Control Valve	N001 L05M015	Mechanical room E058
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer:	Christopher Kirkbride 06/10/2025 Description in panel needs to be changed to mechanical room E058

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
----------------	---------	-------------

Model:

Created By: Christopher Kirkbride  
 Creation Date: 06/10/2025  
 Corrective Action: Tamper reports to panel as alarm  
 Proposed Solution:  
 Manufacturer:  
 Model:

HVAC Shutdown	N001 L07M013	AHU F shut down
---------------	--------------	-----------------

Created By: Christopher Kirkbride  
 Creation Date: 06/10/2025  
 Corrective Action: Description in panel needs to be changed to AHU F shut down  
 Proposed Solution:  
 Manufacturer:  
 Model:

Fan Control	N001 L07M014	AHU F FAN CONTROL
-------------	--------------	-------------------

Created By: Christopher Kirkbride  
 Creation Date: 06/10/2025  
 Corrective Action: Description in panel needs to be changed to AHU F fan control  
 Proposed Solution:  
 Manufacturer:  
 Model:

Fan Control	N001 L07M015	AHU f fan control
-------------	--------------	-------------------

Created By: Christopher Kirkbride  
 Creation Date: 06/10/2025  
 Corrective Action: Description in panel needs to be changed to AHU F fan control  
 Proposed Solution:  
 Manufacturer:  
 Model:

Fan Control	N001 L07M016	AHU F fan control
-------------	--------------	-------------------

Created By: Christopher Kirkbride  
 Creation Date: 06/10/2025  
 Corrective Action: Description in panel needs to be changed to AHU F fan control  
 Proposed Solution:  
 Manufacturer:  
 Model:

Fan Control	N001 L07M017	AHU F fan control
-------------	--------------	-------------------

Created By: Christopher Kirkbride  
 Creation Date: 06/10/2025  
 Corrective Action: Description in panel needs to be changed to AHU F fan control  
 Proposed Solution:  
 Manufacturer:  
 Model:

Fan Control	N001 L07M018	AHU F fan control
-------------	--------------	-------------------

Created By: Christopher Kirkbride  
 Creation Date: 06/10/2025  
 Corrective Action: Description in panel needs to be changed to AHU F fan control  
 Proposed Solution:  
 Manufacturer:  
 Model:

[Other]	N001 L07M019	Antifreeze system
---------	--------------	-------------------

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description and panel needs to be changed to antifreeze system
Supervisory - Control Valve	N001 L03M030	Mechanical room, C
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description in panel needs to be changed to mechanical room C
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Tamper reported as alarm
Fan Control	N001 L06M013	G Block fan control
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description and panel needs to be changed to G block fan control area b
Fan Control	N001 L06M014	G Block fan control
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description and panel needs to be changed to G block fan control area c
Fan Control	N001 L06M015	G Block fan control
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description and panel needs to be changed to G block fan control area d
Fan Control	N001 L06M016	G Block fan control
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description and panel needs to be changed to G block fan control area e
Fan Control	N001 L06M017	G Block fan control
	Created By: Creation Date: Corrective Action: Proposed Solution:	Christopher Kirkbride 06/10/2025 Description and panel needs to be changed to G block fan control area f

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	
Fan Control	N001 L06M018	G Block fan control
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description and panel needs to be changed to G block fan control corridor
HVAC Shutdown	N001 L06M019	G block HVAC shut down
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description and panel needs to be changed to G Block HVAC shut down
HVAC Shutdown	N001 L08M017	AHU H shutdown
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description in panel needs to be changed to POD H MEZZANINE SHUTDOWN
HVAC Shutdown	N001 L08M018	AHU H shutdown
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description in panel needs to be changed to POD H MEZZANINE SHUTDOWN
Fan Control	N001 L08M019	AHU H fan control
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description in panel needs to be changed to AHU H fan control pod h
Fan Control	N001 L08M020	AHU H fan control
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description in panel needs to be changed to AHU H fan control
Fan Control	N001 L08M021	AHU H fan control
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description in panel needs to be changed to AHU H fan control

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Door Control Relay	N001 L08M022	Door control relay
	Created By:	Christopher Kirkbride
	Creation Date:	06/10/2025
	Corrective Action:	Description in panel needs to be changed to door control relay
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L08M034	Antifreeze system
	Created By:	Christopher Kirkbride
	Creation Date:	06/10/2025
	Corrective Action:	Description in panel needs to be changed to Antifreeze system
	Proposed Solution:	
	Manufacturer:	
	Model:	
Fan Control	N001 L05M016	Pod E fan control
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description to POD E FAN CONTROL
	Proposed Solution:	
	Manufacturer:	
	Model:	
Door Holder Release	N001 L05M017	POD E DOOR RELEASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description to POD E DOOR RELEASE
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L05M050	E POD CONTROL TOWER
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description in panel to E POD CONTROL TOWER
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Supervisory - Control Valve	N001 L05M080	Module L05M080
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	
	Model:	
Manual Fire Box	N001 L06M001	POD G SOUTH EXIT
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description in panel to POD G SOUTH EXIT
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L06M002	GD PIPE CHASE EXIT
	Created By:	Chase Buchanan

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to GD PIPE CHASE EXIT
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L06M003	GE PIPE CHASE EXIT
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to GE PIPE CHASE EXIT
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L06M004	GF PIPE CHASE EXIT
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to GF PIPE CHASE EXIT
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
[Other]	N001 L06M005	D HALL EXIT
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description on panel to D HALL EXIT
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L06M006	D HALL CORRIDOR EXIT
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description in panel to D HALL CORRIDOR EXIT
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L06M007	GA PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to GA PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L06M008	GA PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to GA PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L06M010	Module L06M010
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER NBG12LX
Manual Fire Box	N001 L06M011	POD G CONTROL TOWER
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device description to POD G CONTROL TOWER  NOTIFIER NBG12LX
Fan Control	N001 L06M012	G Block fan control
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device description to EXHUST FAN POD G AREA A   NOTIFIER NBG12LX
[Other]	N001 L05M004	Module L05M004
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Device could not be located based off description   NOTIFIER NBG12LX
Supervisory - Control Valve	N001 L01M020	Riser closet on second floor corridor
	Created By: Creation Date: Corrective Action:  Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description and panel needs to be changed to riser closet on second floor corridor   NOTIFIER NBG12LX
Smoke Detector - General	N001 L01D082	2nd floor corridor storage room d block
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Description needs to be changed to 2ND FL CORRIDOR D AREA STORAGE   NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D084	Detector L01D084
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description   NOTIFIER SDX-551, FSP-851, FSP-951IV
Manual Fire Box	N001 L07M001	POD F DATA RM
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Description in panel needs to be changed to POD F DATA RM   NOTIFIER NBG12LX

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Manual Fire Box	N001 L07M002	FC PIPE CHASE EXIT BOILER RM
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to FC PIPE CHASE EXIT BOILER RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L07M004	FD PIPE CHASE EXIT
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to FD PIPE CHASE EXIT
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
[Other]	N001 L07M005	Pod F North stair exit
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Description needs to be changed to POD F NORTH STAIR EXIT
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
[Other]	N001 L07M006	Pod F North exit
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to F POD EXIT
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L07M007	FC PIPE CHASE EXIT 2
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to FC PIPE CHASE EXIT 2
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L07M008	FC PIPE CHASE EXIT #1
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to FC PIPE CHASE EXIT 1
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L07M009	FA PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to FA PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L07M010	SALLY PORT ACROSS FROM I POD

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change description of device in panel to SALLY PORT ACROSS FROM I POD  NOTIFIER NBG12LX
[Other]	N001 L07M011	Pod E exit to FC corridor
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Description needs to be changed to POD F EXIT TO FC CORRIDOR  NOTIFIER NBG12LX
Manual Fire Box	N001 L07M012	POD F Control Tower
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Description needs to be changed in panel to POD f control tower  NOTIFIER NBG12LX
Supervisory - Control Valve	N001 L06M020	Module L06M020
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description    
Manual Fire Box	N001 L07M003	FD PIPE CHASE EXIT 2
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change description in panel to FD PIPE CHASE EXIT 2  NOTIFIER NBG12LX
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L01M019	Riser closet on second floor corridor
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description in panel needs to be changed to riser closet second floor corridor    
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L01M021	Second floor corridor, sprinkler closet
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 Description needs to be changed to second floor corridor sprinkler closet over kitchen    
Supervisory - Control Valve	N001 L01M022	Second floor corridor, sprinkler closet over kitchen
	Created By:	Christopher Kirkbride

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/10/2025
	Corrective Action:	Device reported as alarm
	Proposed Solution:	
	Manufacturer:	
	Model:	
	Created By:	Christopher Kirkbride
	Creation Date:	06/10/2025
	Corrective Action:	Description and panel needs to be changed to second floor corridor sprinkler closet
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L01M075	dpod corridor sliders
	Created By:	Christopher Kirkbride
	Creation Date:	06/10/2025
	Corrective Action:	Description and panel needs to be changed to D pod corridor sliders
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Smoke Detector - General	N001 L01D095	RECEPTION JANITORS CLOSET
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Description in panel needs to be changed to RECEPTION JANITORS CLOSET
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D001	CONTROL TOWER POD B
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Description needs to be changed to CONTROL TOWER POD B
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D002	CONTROL TOWER POD B
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Description needs to be changed to CONTROL TOWER POD B AHU 2B
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D003	CONTROL TOWER POD B
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Description needs to be changed to CONTROL TOWER POD B
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D004	STORAGE ACROSS MEDICAL POD B
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Description needs to be changed to STORAGE ACROSS MEDICAL POD B
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D007	COMMON AREA POD B SALLY PORT
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Description needs to be changed to COMMON AREA POD B SALLY PORT  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D005	STORAGE ACROSS MEDICAL POD B
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Description needs to be changed to STORAGE ACROSS MEDICAL POD B  NOTIFIER SDX-551, FSP-851, FSP-951IV
[Other]	N001 L01M007	Mechanical rm C246
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to Mechanical rm C246  NOTIFIER NBG12LX
Smoke Detector - General	N001 L02D050	Mechanical room B246 2nd floor
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to Mechanical room B246 2nd floor  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D051	Mechanical room B246
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to Mechanical room B246  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D052	Mechanical room B246
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to Mechanical room B246  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D056	CORRIDOR D HALL
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location in panel to CORRIDOR D HALL  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L02D057	CORRIDOR D HALL AT SMOKE DOOR
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to CORRIDOR D HALL AT SMOKE DOOR
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D058	CORRIDOR D HALL
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to CORRIDOR D HALL
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D059	CORRIDOR D HALL
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location in panel to CORRIDOR D HALL
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D060	CORRIDOR OUTSIDE C POD
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to CORRIDOR OUTSIDE C POD
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D061	1ST FL CORRIDOR OUTSIDE STORAGE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to 1ST FL CORRIDOR OUTSIDE STORAGE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D045	Mechanical rm C246
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to Mechanical rm C246
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D046	Mechanical rm C246
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to Mechanical rm C246
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D047	Mechanical rm C246
	Created By:	Chase Buchanan

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to Mechanical rm C246
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D048	Mechanical rm C246
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to Mechanical rm C246
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Heat Detector - Restorable Spot	N001 L06D073	MECHANICAL RM D HALL CORRIDOR
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location in panel to MECHANICAL RM D HALL CORRIDOR
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	FST-851
Smoke Detector - General	N001 L06D074	MECHANICAL RM D HALL CORRIDOR
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location in panel to MECHANICAL RM D HALL CORRIDOR
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D055	CENTRAL HALL CORRIDOR POD A
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to CENTRAL HALL CORRIDOR POD A
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D059	2ND FL FILES RM
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to 2ND FL FILES RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D087	CORRIDOR OUTSIDE B POD
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to CORRIDOR OUTSIDE B POD
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D088	CORRIDOR D HALL AT SMOKE DOOR
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location in panel to CORRIDOR D HALL AT SMOKE DOOR
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D038	E POD MECHANICAL RM
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location in panel to E POD MECHANICAL RM  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D049	COMMON AREA POD D
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to COMMON AREA POD D  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D050	COMMON AREA POD D
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change address in panel to COMMON AREA POD D  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D051	COMMON AREA POD D
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change address in panel to COMMON AREA POD D  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D099	E POD MECHANICAL RM
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location in panel to E POD MECHANICAL RM  NOTIFIER SDX-551, FSP-851, FSP-951IV
Heat Detector - Restorable Spot	N001 L07D001	POD F DATA RM
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Description in panel needs to be changed to POD F DATA RM  NOTIFIER FST-851
Smoke Detector - General	N001 L08D130	HOSPITAL CORRIDOR
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location in panel to HOSPITAL CORRIDOR  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L08D131	HOSPITAL CORRIDOR
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location in panel to HOSPITAL CORRIDOR
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D065	D HALL STORAGE RM
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Description in panel needs to be changed to D HALL STORAGE RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D054	POD F DATA RM
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Description in panel needs to be changed to POD F DATA RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D063	D HALL FOOD STORAGE RM
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Description in panel needs to be changed to D HALL FOOD STORAGE RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Heat Detector - Restorable Spot	N001 L07D052	POD F DATA RM
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Description in panel needs to be changed to POD F DATA RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	FST-851
[Other]	N001 L08M004	MEDICAL RECEPTIONS DESK
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Description in panel needs to be changed to MEDICAL RECEPTIONS DESK
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
[Other]	N001 L08M015	MEDICAL RECEPTIONS DESK
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Description in panel needs to be changed to MEDICAL RECEPTIONS DESK
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L08M051	ROLL CALL RM
	Created By:	Chase Buchanan

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/10/2025
	Corrective Action:	Description in panel needs to be changed to ROLL CALL RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Smoke Detector - General	N001 L08D001	IT room by FC corridor
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description to IT RM BY FC CORRIDOR
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D002	MECHANICAL RM H POD PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to MECHANICAL RM H POD PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D003	MECHANICAL RM H POD PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description on panel to MECHANICAL RM H POD PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D004	MECHANICAL RM H POD PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description to MECHANICAL RM H POD PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D005	MECHANICAL RM H POD PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description to MECHANICAL RM H POD PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D023	MECHANICAL RM H POD PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to MECHANICAL RM H POD PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D026	MECHANICAL RM H POD PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to MECHANICAL RM H POD PIPE CHASE
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector	N001 L08M001	CORRIDOR BY MEDICAL
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change description in panel to CORRIDOR BY MEDICAL  NOTIFIER NBG12LX
Manual Fire Box	N001 L08M002	Module L08M002
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Device could not be located based off description  NOTIFIER NBG12LX
[Other]	N001 L08M003	MEDICAL EMERGENCY EXIT SALLYPORT
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change description in report to MEDICAL EMERGENCY EXIT SALLYPORT  NOTIFIER NBG12LX
[Other]	N001 L08M005	outside mechanical slider
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change description to OUTSIDE MECHANICAL SLIDER  NOTIFIER NBG12LX
Manual Fire Box	N001 L08M006	MECHANICAL RM H POD PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change description in panel to MECHANICAL RM H POD PIPE CHASE EXIT  NOTIFIER NBG12LX
Manual Fire Box	N001 L08M016	H pod tower
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change description to H POD TOWER  NOTIFIER NBG12LX
[Other]	N001 L08M007	Module L08M007
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER NBG12LX

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Manual Fire Box	N001 L08M008	MMH PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to MMH PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L08M009	MMH PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to MMH PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L08M010	MMH PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to MMH PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L08M011	FMH PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to FMH PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Supervisory - Control Valve	N001 L02M030	Mechanical room B246
	Created By:	Christopher Kirkbride
	Creation Date:	06/10/2025
	Corrective Action:	Description and panel needs to be changed to B246 mechanical room
	Proposed Solution:	
	Manufacturer:	
	Model:	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L01M016	2nd floor paper storage
	Created By:	Christopher Kirkbride
	Creation Date:	06/10/2025
	Corrective Action:	Description needs to be changed to 2nd floor paper storage
	Proposed Solution:	
	Manufacturer:	
	Model:	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L01M017	Water flow in ceiling in visitation E
	Created By:	Christopher Kirkbride
	Creation Date:	06/10/2025
	Corrective Action:	Description and panel needs to be changed to water flow in visitation E
	Proposed Solution:	
	Manufacturer:	
	Model:	
Supervisory - Control Valve	N001 L01M018	Tamper in ceiling in visitation E

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Created By:	Christopher Kirkbride
	Creation Date:	06/10/2025
	Corrective Action:	Device reports as alarm
	Proposed Solution:	
	Manufacturer:	
	Model:	
	Created By:	Christopher Kirkbride
	Creation Date:	06/10/2025
	Corrective Action:	Description and panel needs to be changed to tamper in ceiling in visitation E
	Proposed Solution:	
	Manufacturer:	
	Model:	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L08M036	fc chiller room riser I
	Created By:	Christopher Kirkbride
	Creation Date:	06/10/2025
	Corrective Action:	Description needs to be changed to fc chiller room riser I
	Proposed Solution:	
	Manufacturer:	
	Model:	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L08M055	FC CHILLER ROOM RISER F
	Created By:	Christopher Kirkbride
	Creation Date:	06/10/2025
	Corrective Action:	Description in panel needs to be changed to fc chiller room riser F
	Proposed Solution:	
	Manufacturer:	
	Model:	
Smoke Detector - General	N001 L02D008	COMMISSARY POD B
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description to COMMISSARY POD B
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D009	STORAGE ACROSS MEDICAL POD B
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Description needs to be changed to STORAGE ACROSS MEDICAL POD B
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D010	Detector L02D010
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D012	Detector L02D012
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Proposed Solution: Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D013	Detector L02D013
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D014	Detector L02D014
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D015	Detector L02D015
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D016	Detector L02D016
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D017	Detector L02D017
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D018	Detector L02D018
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D019	Detector L02D019
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L02D020	Detector L02D020
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D021	Detector L02D021
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D022	Detector L02D022
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D023	Detector L02D023
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D024	Detector L02D024
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D025	Detector L02D025
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Manual Fire Box	N001 L08M013	F MED PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to F MED PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Manual Fire Box	N001 L08M014	M MED PIPE CHASE

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change description in panel to M MED PIPE CHASE  NOTIFIER NBG12LX
Door Control Relay	N001 L08M023	Door holders, FC corridor
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change description to DOOR HOLDERS FC CORRIDOR    
[Other]	N001 L08M030	Module L08M030
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description    
[Other]	N001 L08M032	Module L08M032
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Device could not be located based off description    
[Other]	N001 L08M033	Module L08M033
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Device could not be located based off description    
[Other]	N001 L08M035	Module L08M035
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Device could not be located based off description    
Smoke Detector - General	N001 L02D011	Detector L02D011
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
[Other]	N001 L08M012	Pod H Sally Port
	Created By: Creation Date: Corrective Action:	Chase Buchanan 06/10/2025 Change description to POD H SALLYPORT

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Proposed Solution: Manufacturer: Model:	NOTIFIER NBG12LX
Supervisory - Control Valve	N001 L08M031	Module L08M031
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description
Manual Fire Box	N001 L08M050	Module L08M050
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Device could not be located based off description NOTIFIER NBG12LX
Smoke Detector - General	N001 L01D002	Detector L01D002
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D004	Detector L01D004
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D006	Detector L01D006
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D034	Detector L04D034
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change description in panel to D POD MECH RM 013 NOTIFIER SDX-551, FSP-851, FSP-951IV
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/12/2025 Device is showing no answer on panel NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L06D039	Detector L06D039
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to POD G AREA E
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D015	Detector L07D015
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to POD F AREA D
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Manual Fire Box	N001 L08M052	FC chiller room exit
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description to MECHANICAL RM FC
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
	Created By:	Christopher Kirkbride
	Creation Date:	06/10/2025
	Corrective Action:	Description in panel needs to be changed to FC chiller room exit
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L08M057	Module L08M057
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description to POD H
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L08M053	Module L08M053
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
----------------	---------	-------------

Model:

[Other]	N001 L08M056	Module L08M056
---------	--------------	----------------

Created By: Chase Buchanan  
 Creation Date: 06/10/2025  
 Corrective Action: Change description to POF F CONTROL VALVE  
 Proposed Solution:  
 Manufacturer:  
 Model:

Created By: Christopher Kirkbride  
 Creation Date: 06/12/2025  
 Corrective Action: Device is showing no answer on panel  
 Proposed Solution:  
 Manufacturer:  
 Model:

Smoke Detector - General	N001 L06D009	Detector L06D009
--------------------------	--------------	------------------

Created By: Chase Buchanan  
 Creation Date: 06/10/2025  
 Corrective Action: Change description in panel to POD G CHASE F  
 Proposed Solution:  
 Manufacturer: NOTIFIER  
 Model: SDX-551, FSP-851, FSP-951IV

Created By: Christopher Kirkbride  
 Creation Date: 06/12/2025  
 Corrective Action: Device is showing no answer on panel  
 Proposed Solution:  
 Manufacturer: NOTIFIER  
 Model: SDX-551, FSP-851, FSP-951IV

Smoke Detector - General	N001 L02D038	Detector L02D038
--------------------------	--------------	------------------

Created By: Chase Buchanan  
 Creation Date: 06/10/2025  
 Corrective Action: Change description in panel to DAYROOM B POD AREA D  
 Proposed Solution:  
 Manufacturer: NOTIFIER  
 Model: SDX-551, FSP-851, FSP-951IV

Created By: Christopher Kirkbride  
 Creation Date: 06/12/2025  
 Corrective Action: Device is showing no answer on panel  
 Proposed Solution:  
 Manufacturer: NOTIFIER  
 Model: SDX-551, FSP-851, FSP-951IV

Smoke Detector - General	N001 L07D022	Detector L07D022
--------------------------	--------------	------------------

Created By: Chase Buchanan  
 Creation Date: 06/10/2025  
 Corrective Action: Change description in panel to POD F AREA A  
 Proposed Solution:  
 Manufacturer: NOTIFIER  
 Model: SDX-551, FSP-851, FSP-951IV

Created By: Christopher Kirkbride  
 Creation Date: 06/12/2025  
 Corrective Action: Device is showing no answer on panel  
 Proposed Solution:  
 Manufacturer: NOTIFIER

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D023	Detector L07D023
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to POD F AREA A
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D029	Detector L07D029
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to POD F AREA B
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D016	Detector L04D016
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to LAUNDRY
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D012	Detector L07D012
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to POD F AREA D
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D046	Detector L07D046
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D040	Detector L06D040
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to POD G AREA E
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D042	Detector L06D042
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to POD G AREA E
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D049	Detector L06D049
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to POD G AREA C
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D065	Detector L06D065
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change description in panel to POD G AREA A

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Proposed Solution: Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/12/2025 Device is showing no answer on panel NOTIFIER SDX-551, FSP-851, FSP-951IV
Heat Detector - Restorable Spot	N001 L04D006	Detector L04D006
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change description in panel to KITCHEN HEAT NOTIFIER FST-851
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/12/2025 Device is showing a test F on panel NOTIFIER FST-851
Smoke Detector - General	N001 L03D043	Detector L03D043
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change description in panel to POD F DAY ROOM C NOTIFIER SDX-551, FSP-851, FSP-951IV
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/12/2025 Device is showing maintenance required at panel NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D001	Detector L01D001
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D003	Detector L01D003
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D005	Detector L01D005
	Created By:	Chase Buchanan

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D008	Detector L01D008
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D009	Detector L01D009
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D010	Detector L01D010
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D012	Detector L01D012
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D014	Detector L01D014
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D015	Detector L01D015
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D016	Detector L01D016
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D017	Detector L01D017
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D018	Detector L01D018
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D019	Detector L01D019
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D020	Detector L01D020
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D021	Detector L01D021
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D022	Detector L01D022
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D023	Detector L01D023
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L01D024	Detector L01D024
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D025	Detector L01D025
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D026	Detector L01D026
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D027	Detector L01D027
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D028	Detector L01D028
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D029	Detector L01D029
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D030	Detector L01D030
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D031	Detector L01D031
	Created By:	Chase Buchanan

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D032	Detector L01D032
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D033	Detector L01D033
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D034	Detector L01D034
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D035	Detector L01D035
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D036	Detector L01D036
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D037	Detector L01D037
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D038	Detector L01D038
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D039	Detector L01D039
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D040	Detector L01D040
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D041	Detector L01D041
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D042	Detector L01D042
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D043	Detector L01D043
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D044	Detector L01D044
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D045	Detector L01D045
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L01D046	Detector L01D046
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description on panel to A POD COMMON AREA
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D047	Detector L01D047
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D048	Detector L01D048
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description on panel to A POD COMMON AREA
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D049	Detector L01D049
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D050	Detector L01D050
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D060	Detector L01D060
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D063	Detector L01D063
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D007	Detector L01D007
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D011	Detector L01D011
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D076	Detector L01D076
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D077	Detector L01D077
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D078	2nd floor elevator lobby
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to ELEVATOR LOBBY 2ND FL  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D026	Detector L02D026
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L02D028	Detector L02D028
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D029	Detector L02D029
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D030	Detector L02D030
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D031	Detector L02D031
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D032	Detector L02D032
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D033	DAY ROOM B POD AREA F
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to DAY ROOM B POD AREA F
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D034	DAY ROOM B POD AREA F
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to DAY ROOM B POD AREA F
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D036	DAY ROOM B POD AREA E
	Created By:	Chase Buchanan

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to DAY ROOM B POD AREA E
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D037	DAY ROOM B POD AREA D
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to DAY ROOM B POD AREA D
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D039	DAY ROOM B POD AREA C
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to DAY ROOM B POD AREA C
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D040	DAY ROOM B POD AREA C
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to DAY ROOM B POD AREA C
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D041	DAY ROOM B POD AREA B
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to DAY ROOM B POD AREA B
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D042	DAY ROOM B POD AREA B
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to DAY ROOM B POD AREA B
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D043	B POD AREA A
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to B POD AREA A
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D044	B POD AREA A
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to B POD AREA A
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D045	COMMON AREA POD B
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to COMMON AREA POD B  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D046	COMMON AREA POD B
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to COMMON AREA POD B  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D047	COMMON AREA POD B
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to COMMON AREA POD B  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D048	COMMON AREA POD B
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to COMMON AREA POD B  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D049	COMMON AREA POD B
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to COMMON AREA POD B  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D054	janitors closet, pod b
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to JANITORS CLOSET POD B  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L01D068	Detector L01D068
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L02D027	Detector L02D027
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D014	Detector L03D014
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D001	CONTROL TOWER POD C
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to CONTROL TOWER POD C
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D002	CONTROL TOWER POD C
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to CONTROL TOWER POD C
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D003	CONTROL TOWER POD C
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to CONTROL TOWER POD C
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D005	STORAGE RM C POD
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to C POD STORAGE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D006	JANITORS CLOSET POD C
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to JANITORS CLOSET POD C
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D007	SUPERVISORS OFFICE POD C
	Created By:	Chase Buchanan

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to SUPERVISORS OFFICE POD C
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D008	COMMON AREA POD C
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to COMMON AREA POD C
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D009	STORAGE POD C
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to STORAGE POD C
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D010	MEDICAL STORAGE C POD
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to MEDICAL STORAGE C POD
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D013	Detector L03D013
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D015	Detector L03D015
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D016	Detector L03D016
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D017	Detector L03D017
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D018	Detector L03D018
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D019	Detector L03D019
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D020	Detector L03D020
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D021	Detector L03D021
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D022	Detector L03D022
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D023	Detector L03D023
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D024	Detector L03D024
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L03D025	Detector L03D025
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D026	Detector L03D026
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D027	Detector L03D027
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D028	Detector L03D028
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D029	Detector L03D029
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D030	Detector L03D030
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D031	Detector L03D031
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to C POD CHASE AREA F
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Corrective Action: Proposed Solution: Manufacturer: Model:	Device is showing maintenance required at panel  NOTIFIER SDX-551, FSP-851, FSP-951V
Smoke Detector - General	N001 L03D032	Detector L03D032
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951V
Smoke Detector - General	N001 L03D033	DAY ROOM C POD AREA A
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to DAY ROOM C POD AREA A  NOTIFIER SDX-551, FSP-851, FSP-951V
Smoke Detector - General	N001 L03D034	DAY ROOM C POD AREA A
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to DAY ROOM C POD AREA A  NOTIFIER SDX-551, FSP-851, FSP-951V
Smoke Detector - General	N001 L03D035	DAY ROOM C POD AREA B
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to DAY ROOM C POD AREA B  NOTIFIER SDX-551, FSP-851, FSP-951V
Smoke Detector - General	N001 L03D036	DAY ROOM C POD AREA B
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to DAY ROOM C POD AREA B  NOTIFIER SDX-551, FSP-851, FSP-951V
Smoke Detector - General	N001 L03D037	DAY ROOM C POD AREA C
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/10/2025 Change device location on panel to DAY ROOM C POD AREA C  NOTIFIER SDX-551, FSP-851, FSP-951V
Smoke Detector - General	N001 L03D038	DAY ROOM C POD AREA C
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer:	Chase Buchanan 06/10/2025 Change device location on panel to DAY ROOM C POD AREA C  NOTIFIER

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D039	DAY ROOM C POD AREA D
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to DAY ROOM C POD AREA D
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D040	DAY ROOM C POD AREA D
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to DAY ROOM C POD AREA D
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D041	DAY ROOM C POD AREA E
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to DAY ROOM C POD AREA E
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D042	DAY ROOM C POD AREA E
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to DAY ROOM C POD AREA E
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D044	DAY ROOM C POD AREA F
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to DAY ROOM C POD AREA F
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D049	COMMON AREA POD C
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to COMMON AREA POD C
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D050	COMMON AREA POD C
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to COMMON AREA POD C
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L03D051	COMMON AREA POD C
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to COMMON AREA POD C
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D052	COMMON AREA POD C
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location on panel to COMMON AREA POD C
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D008	Kitchen
	Created By:	Chase Buchanan
	Creation Date:	06/11/2025
	Corrective Action:	Change device in panel to KITCHEN HEAT
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D009	Maintenance office
	Created By:	Chase Buchanan
	Creation Date:	06/11/2025
	Corrective Action:	Change device in panel to MAINTENANCE OFFICE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D010	Laundry storage
	Created By:	Chase Buchanan
	Creation Date:	06/11/2025
	Corrective Action:	Change device in panel to LAUNDRY STORAGE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D012	Laundry
	Created By:	Chase Buchanan
	Creation Date:	06/11/2025
	Corrective Action:	Change device in panel to LAUNDRY
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D017	Laundry storage
	Created By:	Chase Buchanan
	Creation Date:	06/11/2025
	Corrective Action:	Change device in panel to LAUNDRY STORAGE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D025	Warehouse
	Created By:	Chase Buchanan

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/11/2025
	Corrective Action:	Change device in panel to WAREHOUSE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D020	Staff dining
	Created By:	Chase Buchanan
	Creation Date:	06/11/2025
	Corrective Action:	Change device in panel to STAFF DINING
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D031	Detector L04D031
	Created By:	Chase Buchanan
	Creation Date:	06/11/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D032	T2 DAY RM
	Created By:	Chase Buchanan
	Creation Date:	06/11/2025
	Corrective Action:	Change device address in panel to T2 DAY RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D033	T1 Day Rm
	Created By:	Chase Buchanan
	Creation Date:	06/11/2025
	Corrective Action:	Change address in panel to T1 DAY RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D045	Detector L04D045
	Created By:	Chase Buchanan
	Creation Date:	06/11/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D046	Detector L04D046
	Created By:	Chase Buchanan
	Creation Date:	06/11/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D047	Detector L04D047
	Created By:	Chase Buchanan
	Creation Date:	06/11/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L04D052	Laundry
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/11/2025 Change address in panel to LAUNDRY  NOTIFIER SDX-551, FSP-851, FSP-951IV
Manual Fire Box	N005 L01M009	SALLYPORT 1075
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/11/2025 Could not locate based off description of device  NOTIFIER NBG12LX
Supervisory - Control Valve	N001 L04M020	Tamper in back warehouse, D-Block
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/11/2025 Description and panel needs to be changed to tamper in D-Block warehouse.    Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:
		Christopher Kirkbride 06/11/2025 Tamper reports to panel as a fire alarm
Supervisory - Control Valve	N001 L05M020	tamper above E pod control tower
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/11/2025 Description needs to be changed to Tamper above E pod control tower    
Remote Annunciator		Booking control room, A Pod
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/11/2025 Annunciator does not appear to be functioning properly  NOTIFIER LCD-80
Battery - Sealed Lead-acid		Sub FACP panel in I pod battery 1
	Created By: Creation Date: Corrective Action:  Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/11/2025 Battery has exceeded service life  12v55ah  12v55ah

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
----------------	---------	-------------

Battery - Sealed Lead-acid		Sub FACP panel in I pod battery 2
	Created By:	Christopher Kirkbride
	Creation Date:	06/11/2025
	Corrective Action:	Battery has exceeded service life
		12v55ah
	Proposed Solution:	
	Manufacturer:	
	Model:	12v55ah

Remote Annunciator		Booking control I Pod
	Created By:	Christopher Kirkbride
	Creation Date:	06/11/2025
	Corrective Action:	Annunciator is missing labels
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	LCD-80



Fire Alarm Panel	N005 N005	Sub FACP panel in I pod
	Created By:	Christopher Kirkbride
	Creation Date:	06/11/2025
	Corrective Action:	Trouble strobe circuit number two open upon arrival
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	NFS 320



Smoke Detector - General	N001 L04D037	Detector L04D037
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV

Smoke Detector - General	N001 L05D070	Detector L05D070
	Created By:	Christopher Kirkbride

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D072	Detector L05D072
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D045	Detector L06D045
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Supervisory - Control Valve	N001 L01M023	Module L01M023
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	
	Model:	
Smoke Detector - General	N001 L04D096	Detector L04D096
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D015	Detector L08D015
	Created By:	Christopher Kirkbride
	Creation Date:	06/12/2025
	Corrective Action:	Device is showing no answer on panel
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Heat Detector - Restorable Spot	N001 L06D075	D HALL MECHANICAL RM
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description if device in panel to D HALL MECHANICAL RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	FST-851
Smoke Detector - General	N001 L08D014	FMH PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FMH PIPE CHASE
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D016	FMH PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to FMH PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D017	FMH PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to FMH PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D018	MMH PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to MMH PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D019	MMH PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to MMH PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D020	MMH PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to MMH PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D021	MMH PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to MMH PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D022	MMH PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to MMH PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L07D002	FF PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FF PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D003	FF PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FF PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D004	FF PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FF PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D005	FE PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FE PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D006	FE PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FE PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D007	FE PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FE PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D008	FD PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FD PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D009	FD PIPE CHASE
	Created By:	Chase Buchanan

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FD PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D010	FD PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FD PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D011	FD PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FD PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D013	FC PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FC PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D014	FC PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FC PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D017	FB PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FB PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D018	FB PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FB PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D019	FA PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to FA PIPE CHASE
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D020	FB PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to FA PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D021	FA PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to FA PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D006	M MED PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to M MED PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D007	M MED PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to M MED PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D008	M MED PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to M MED PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D009	M MED PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to M MED PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D010	F MED PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to F MED PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L08D011	F MED PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to F MED PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D012	F MED PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to F MED PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D013	F MED PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to F MED PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D013	GA PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GA PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D014	GA PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GA PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D001	GD PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GD PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D002	GD PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GD PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D004	GD PIPE CHASE
	Created By:	Chase Buchanan

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GD PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D005	GD PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GD PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D015	GA PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GA PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D016	GA PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GA PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D017	GB PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GB PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D018	GB PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GB PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D019	GB PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GB PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D020	GA PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GA PIPE CHASE
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D021	GC PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to GC PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D022	GC PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to GC PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D023	GB PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to GB PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D024	GC PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to GC PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Manual Fire Box	N001 L06M009	GC PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to GC PIPE CHASE EXIT  NOTIFIER NBG12LX
Smoke Detector - General	N001 L06D006	GE PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to GE PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D007	GF PIPE CHASE
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description in panel to GE PIPE CHASE  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L06D008	GF PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GE PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D011	GF PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GF PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D012	GF PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description in panel to GF PIPE CHASE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L02D006	B POD SALLY PORT
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change location of device on panel to B POD SALLY PORT
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L03D004	STORAGE RM C POD
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Description needs to be changed to C POD STORAGE
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D029	E POD TOWER BASEMENT
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description of device in panel to E POD TOWER BASMENT
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D030	E POD TOWER BASEMENT
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description of device in panel to E POD TOWER BASEMENT
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D060	E POD MAIN CORRIDOR
	Created By:	Chase Buchanan

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/12/2025
	Corrective Action:	Change description of device in panel to E POD MAIN CORRIDOR
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D061	E POD MAIN CORRIDOR
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description of device in panel to E POD MAIN CORRIDOR
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Heat Detector - Restorable Spot	N001 L05D041	E POD B WATER HEATER RM
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description of device in panel to E POD B WATER HEATER RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	FST-851
Smoke Detector - General	N001 L05D056	E POD BLOCK D DAY RM
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description of device in panel to E POD BLOCK D DAY RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D057	E POD BLOCK D DAY RM
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description of device in panel to E POD BLOCK D DAY RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D058	E POD E BLOCK
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description of device in panel to E POD E BLOCK
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D059	E POD E BLOCK
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description of device in panel to E POD E BLOCK
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D062	E POD CORRIDOR
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description of device in panel to E POD CORRIDOR
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D063	E POD CORRIDOR
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description of device in panel to E POD CORRIDOR  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D064	E POD MAIN CORRIDOR
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description of device in panel to E POD MAIN CORRIDOR  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D049	E POD A BLOCK DAY RM
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description of device in panel to E POD A BLOCK DAY RM  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D050	E POD A BLOCK DAY RM
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description of device in panel to E POD A BLOCK DAY RM  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D051	E POD B DAY RM
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description of device in panel to E POD B DAY RM  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D052	E POD B DAY RM
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description of device in panel to E POD B DAY RM  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D053	E POD MAIN CORRIDOR
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Chase Buchanan 06/12/2025 Change description of device in panel to E POD MAIN CORRIDOR  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L05D054	E POD C BLOCK DAY RM
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description of device in panel to E POD C BLOCK DAY RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D055	E POD C BLOCK DAY RM
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025
	Corrective Action:	Change description of device in panel to E POD C BLOCK DAY RM
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D068	Detector L08D068
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D069	Detector L08D069
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D072	Detector L08D072
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D073	Detector L08D073
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D074	Detector L08D074
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D075	Detector L08D075
	Created By:	Christopher Kirkbride

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D076	Detector L08D076
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D077	Detector L08D077
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D078	Detector L08D078
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D079	Detector L08D079
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D080	Detector L08D080
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D081	Detector L08D081
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D082	Detector L08D082
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D083	Detector L08D083
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/13/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D084	Detector L08D084
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/13/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D085	Detector L08D085
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/13/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D086	Detector L08D086
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/13/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D087	Detector L08D087
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/13/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D088	Detector L08D088
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/13/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D089	Detector L08D089
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/13/2025 Could not locate device based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L08D090	Detector L08D090
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D091	Detector L08D091
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D092	Detector L08D092
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D093	Detector L08D093
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D094	Detector L08D094
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D095	Detector L08D095
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D096	Detector L08D096
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D097	Detector L08D097
	Created By:	Christopher Kirkbride

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D098	Detector L08D098
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D099	Detector L08D099
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
[Other]	N001 L05M031	Module L05M031
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L05M032	Module L05M032
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L05M061	Module L05M061
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L05M062	Module L05M062
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L05M070	Module L05M070
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	
[Other]	N001 L05M073	Module L05M073
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description
[Other]	N001 L07M020	Module L07M020
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description
[Other]	N001 L01M006	Module L01M006
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description NOTIFIER NBG12LX
[Other]	N001 L06M155	Module L06M155
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description
[Other]	N001 L06M156	Module L06M156
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description
[Other]	N001 L06M157	Module L06M157
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description
[Other]	N001 L06M158	Module L06M158
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
[Other]	N001 L06M159	Module L06M159
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L04M001	Module L04M001
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L04M002	Module L04M002
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L02M002	Module L02M002
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	
	Model:	
[Other]	N001 L04M014	Module L04M014
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	
	Model:	
Smoke Detector - General	N001 L06D003	Detector L06D003
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D010	Detector L06D010
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D025	Detector L06D025
	Created By:	Carlos Hernandez

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D026	Detector L06D026
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D027	Detector L06D027
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D028	Detector L06D028
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D029	Detector L06D029
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D030	Detector L06D030
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D031	Detector L06D031
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D032	Detector L06D032
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D033	Detector L06D033
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D034	Detector L06D034
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D035	Detector L06D035
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D036	Detector L06D036
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D037	Detector L06D037
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D038	Detector L06D038
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D041	Detector L06D041
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L06D043	Detector L06D043
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D044	Detector L06D044
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D046	Detector L06D046
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D057	Detector L06D057
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D058	Detector L06D058
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D059	Detector L06D059
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D060	Detector L06D060
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D061	Detector L06D061
	Created By:	Carlos Hernandez

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D062	Detector L06D062
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D063	Detector L06D063
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D064	Detector L06D064
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D066	Detector L06D066
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D067	Detector L06D067
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D068	Detector L06D068
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D069	Detector L06D069
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D070	Detector L06D070
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D071	Detector L06D071
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D072	Detector L06D072
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D047	Detector L06D047
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D048	Detector L06D048
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D050	Detector L06D050
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D051	Detector L06D051
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L06D052	Detector L06D052
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D053	Detector L06D053
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D054	Detector L06D054
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D055	Detector L06D055
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L06D056	Detector L06D056
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D023	Detector L05D023
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D024	Detector L05D024
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D026	Detector L05D026
	Created By:	Carlos Hernandez

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D028	Detector L05D028
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D031	Detector L05D031
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D032	Detector L05D032
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D033	Detector L05D033
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D034	Detector L05D034
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D035	Detector L05D035
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D036	Detector L05D036
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D038	Detector L05D038
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D039	Detector L05D039
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D040	Detector L05D040
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D042	Detector L05D042
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D043	Detector L05D043
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D044	Detector L05D044
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D065	Detector L05D065
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L05D066	Detector L05D066
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Heat Detector - Restorable Spot	N001 L05D090	Detector L05D090
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	FST-851
Heat Detector - Restorable Spot	N001 L05D045	Detector L05D045
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	FST-851
Smoke Detector - General	N001 L05D046	Detector L05D046
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D047	Detector L05D047
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L05D048	Detector L05D048
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D031	Detector L07D031
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D032	Detector L07D032
	Created By:	Carlos Hernandez

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D033	Detector L07D033
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D034	Detector L07D034
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D035	Detector L07D035
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D036	Detector L07D036
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D037	Detector L07D037
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D038	Detector L07D038
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D039	Detector L07D039
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D040	Detector L07D040
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D041	Detector L07D041
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D016	Detector L07D016
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D024	Detector L07D024
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D025	Detector L07D025
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D026	Detector L07D026
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D027	Detector L07D027
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L07D028	Detector L07D028
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D030	Detector L07D030
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D042	Detector L07D042
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D043	Detector L07D043
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D044	Detector L07D044
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L02M008	Module L02M008
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	
	Model:	
Supervisory - Control Valve	N001 L02M009	Module L02M009
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Could not locate device based off description
	Proposed Solution:	
	Manufacturer:	
	Model:	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L04M021	Module L04M021

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/13/2025 Could not locate device based off description
Supervisory - Control Valve	N001 L04M022	Module L04M022
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/13/2025 Could not locate device based off description
Supervisory	N001 L05M030	Module L05M030
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/13/2025 Could not locate device based off description
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L03M005	Module L03M005
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/13/2025 Could not locate device based off description
Smoke Detector - General	N001 L07D045	Detector L07D045
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D047	Detector L07D047
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D048	Detector L07D048
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L07D049	Detector L07D049
	Created By: Creation Date:	Carlos Hernandez 06/13/2025

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Corrective Action: Proposed Solution: Manufacturer: Model:	Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951V
Smoke Detector - General	N001 L07D050	Detector L07D050
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951V
Smoke Detector - General	N001 L07D051	Detector L07D051
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951V
Smoke Detector - General	N001 L08D057	Detector L08D057
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951V
Smoke Detector - General	N001 L08D058	Detector L08D058
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951V
Smoke Detector - General	N001 L08D059	Detector L08D059
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951V
Smoke Detector - General	N001 L08D060	Detector L08D060
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951V
Smoke Detector - General	N001 L08D061	Detector L08D061
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D062	Detector L08D062
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D063	Detector L08D063
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D064	Detector L08D064
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D065	Detector L08D065
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D066	Detector L08D066
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D067	Detector L08D067
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D070	Detector L08D070
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L08D071	Detector L08D071
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D052	Detector L08D052
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D053	Detector L08D053
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D054	Detector L08D054
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D055	Detector L08D055
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D056	Detector L08D056
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Remote Annunciator		Booking control room, B Pod
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Device shows communication fault
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	LCD-80
Remote Annunciator		Booking control room, E Pod
	Created By:	Christopher Kirkbride

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/13/2025
	Corrective Action:	Device shows communication fault
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	LCD-80
Remote Annunciator		Booking control room, H Pod
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Device shows communication fault
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	LCD-80
Remote Annunciator		Booking control room, F Pod
	Created By:	Christopher Kirkbride
	Creation Date:	06/13/2025
	Corrective Action:	Device shows communication fault
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	LCD-80
Smoke Detector - General	N001 L08D030	Detector L08D030
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D031	Detector L08D031
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D032	Detector L08D032
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D033	Detector L08D033
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D034	Detector L08D034
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D035	Detector L08D035
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D036	Detector L08D036
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D038	Detector L08D038
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D039	Detector L08D039
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D040	Detector L08D040
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D041	Detector L08D041
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D042	Detector L08D042
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
Smoke Detector - General	N001 L08D043	Detector L08D043
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D044	Detector L08D044
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D045	Detector L08D045
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D047	Detector L08D047
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D048	Detector L08D048
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D049	Detector L08D049
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D050	Detector L08D050
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D051	Detector L08D051
	Created By:	Carlos Hernandez

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Heat Detector - Restorable Spot	N001 L08D024	Detector L08D024
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	FST-851
Smoke Detector - General	N001 L08D025	Detector L08D025
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D027	Detector L08D027
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D028	Detector L08D028
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D029	Detector L08D029
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D037	Detector L08D037
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	
	Manufacturer:	NOTIFIER
	Model:	SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D046	Detector L08D046
	Created By:	Carlos Hernandez
	Creation Date:	06/13/2025
	Corrective Action:	Device could not be located based off description
	Proposed Solution:	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
	Manufacturer: Model:	NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D100	Detector L08D100
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D101	Detector L08D101
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D102	Detector L08D102
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Smoke Detector - General	N001 L08D103	Detector L08D103
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Carlos Hernandez 06/13/2025 Device could not be located based off description  NOTIFIER SDX-551, FSP-851, FSP-951IV
Digital Alarm Communicator Transmitter		DIALER next to FACP
	Created By: Creation Date: Corrective Action:  Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/13/2025 Could not verify signals due to system being placed on test before we were on site by CGL. Dialer does not appear to be functioning properly due to the fact that system was not placed on test Every day that we were testing, and the fire department never showed up.  Notifier 911A
N/A	General General	N/A
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer: Model:	Christopher Kirkbride 06/10/2025 HVAC units shut down under general alarm.   
	Created By: Creation Date: Corrective Action: Proposed Solution: Manufacturer:	Christopher Kirkbride 06/10/2025 Elevator recalls under general alarm  

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
----------------	---------	-------------

Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/10/2025	
Corrective Action:	The two tamper switches at the end of the second floor hallway in the paper storage room did not report to the FACP. Addresses of devices unknown.	
Proposed Solution:		
Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/10/2025	
Corrective Action:	The tamper in fc chiller room for riser F did not send signal to panel. The devices address is unknown at this current time.	
Proposed Solution:		
Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/10/2025	
Corrective Action:	The tamper in fc chiller room for riser H did not send signal to panel. The devices address is unknown at this current time.	
Proposed Solution:		
Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/10/2025	
Corrective Action:	The tamper in fc chiller room for riser I did not send signal to panel. The devices address is unknown at this current time.	
Proposed Solution:		
Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/10/2025	
Corrective Action:	The Waterflow in fc chiller room for riser H did not send signal to panel. The devices address is unknown at this current time.	
Proposed Solution:		
Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/10/2025	
Corrective Action:	The tamper in A245 riser did not send signal to panel. The devices address is unknown at this current time.	
Proposed Solution:		
Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/10/2025	
Corrective Action:	The low air in A245 riser did not send signal to panel. The devices address is unknown at this current time.	
Proposed Solution:		
Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/11/2025	
Corrective Action:	The tamper in D hall in the back warehouse did not report to panel the address of device is currently unknown	
Proposed Solution:		

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
----------------	---------	-------------

Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/11/2025	
Corrective Action:	The low air for D-Block rear of warehouse did not activate signal at panel. Address of device is currently unknown.	
Proposed Solution:		
Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/11/2025	
Corrective Action:	The dry system in D Block rear warehouse failed to reset properly.  Upon arrival system was tripped and already activated	
Proposed Solution:		
Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/11/2025	
Corrective Action:	Smoke detector in iPod outside of MT2 is not polling and does not appear to be programmed into FACP	
Proposed Solution:		
Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/12/2025	
Corrective Action:	The FACP is showing a ground fault on loop eight	
Proposed Solution:		
Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/12/2025	
Corrective Action:	B pod janitors closet smoke detector did not function	
Proposed Solution:		
Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/12/2025	
Corrective Action:	There is a smoke detector in B pod D block that did not function	
Proposed Solution:		
Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/12/2025	
Corrective Action:	There is a smoke detector in B pod E block that did not function	
Proposed Solution:		
Manufacturer:		
Model:		
Created By:	Christopher Kirkbride	
Creation Date:	06/12/2025	
Corrective Action:	Smoke detector in corridor at exit of building in C Block at entrance to yard is not pulling	
Proposed Solution:		
Manufacturer:		
Model:		

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
----------------	---------	-------------

Created By: Christopher Kirkbride  
 Creation Date: 06/12/2025  
 Corrective Action: Smoke detector in E pod janitors closet did not report to panel  
 Proposed Solution:  
 Manufacturer:  
 Model:

Created By: Christopher Kirkbride  
 Creation Date: 06/13/2025  
 Corrective Action: Smoke detector in T2 above bunks failed to send signal to panel  
 Proposed Solution:  
 Manufacturer:  
 Model:

Created By: Chase Buchanan  
 Creation Date: 06/13/2025  
 Corrective Action: Pull station front lobby did not activate  
 Proposed Solution:  
 Manufacturer:  
 Model:

Created By: Chase Buchanan  
 Creation Date: 06/13/2025  
 Corrective Action: No access was given to open main mechanical rm  
 Proposed Solution:  
 Manufacturer:  
 Model:

Created By: Chase Buchanan  
 Creation Date: 06/13/2025  
 Corrective Action: Heat in laundry did not activate  
 Proposed Solution:  
 Manufacturer:  
 Model:

Created By: Chase Buchanan  
 Creation Date: 06/13/2025  
 Corrective Action: 1st floor bottom of stairs near elevator did not activate  
 Proposed Solution:  
 Manufacturer:  
 Model:

Created By: Chase Buchanan  
 Creation Date: 06/13/2025  
 Corrective Action: Device missing D hall storage rm  
 Proposed Solution:  
 Manufacturer:  
 Model:

Created By: Chase Buchanan  
 Creation Date: 06/13/2025  
 Corrective Action: 2 smokes in GF Pipe Chase won't go into alarm not polling . Loop and device number unknown due to panel descriptions  
 Proposed Solution:  
 Manufacturer:  
 Model:

Created By: Chase Buchanan  
 Creation Date: 06/13/2025  
 Corrective Action: 2 smokes not polling in BE pod , device loops and device numbers unknown due to panel lacking correct descriptions .

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
----------------	---------	-------------

Proposed Solution:  
 Manufacturer:  
 Model:

Created By: Christopher Kirkbride  
 Creation Date: 06/13/2025  
 Corrective Action: The FACP has a loop that is dropping randomly. The troubles on the panel are going from 40 to 90 intermittently.

Proposed Solution:  
 Manufacturer:  
 Model:

Created By: Christopher Kirkbride  
 Creation Date: 06/13/2025  
 Corrective Action: The strobes in the admin area are out of sync

Proposed Solution:  
 Manufacturer:  
 Model:

Created By: Christopher Kirkbride  
 Creation Date: 06/13/2025  
 Corrective Action: The strobes in the front lobby and lobby restrooms did not function during sound test

Proposed Solution:  
 Manufacturer:  
 Model:

Created By: Christopher Kirkbride  
 Creation Date: 06/13/2025  
 Corrective Action: The 2nd floor Corridor strobes did not sync

Proposed Solution:  
 Manufacturer:  
 Model:

# Resolved Corrective Action & Solution Summary

The following 10 corrective action(s) were resolved during the system inspection, testing or maintenance activities

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
[Other]	N001 L01M009	Mechanical room a 245
	Created By:	Chase Buchanan
	Creation Date:	06/09/2025
	Corrective Action:	Change description to pull station jail admin lobby
	Resolution:	Dup
	Resolved By:	Chase Buchanan
	Resolved On:	06/09/2025
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
[Other]	N001 L01M007	Mechanical rm C246
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device location to Mechanical rm C246
	Resolution:	
	Resolved By:	Chase Buchanan
	Resolved On:	06/10/2025
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Fan Control	N001 L06M012	G Block fan control
	Created By:	Christopher Kirkbride
	Creation Date:	06/10/2025
	Corrective Action:	Description and panel needs to be changed to G block fan control
	Resolution:	Dip
	Resolved By:	Chase Buchanan
	Resolved On:	06/10/2025
	Manufacturer:	
	Model:	
Manual Fire Box	N001 L06M009	GC PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description to POD G CHASE AREA C EXIT
	Resolution:	Dup
	Resolved By:	Chase Buchanan
	Resolved On:	06/12/2025
	Manufacturer:	NOTIFIER
	Model:	NBG12LX
Smoke Detector - General	N005 L01D013	CORRIDOR 1024
	Created By:	Chase Buchanan
	Creation Date:	06/10/2025
	Corrective Action:	Change device description on panel to 2ND FL CORR B AREA SMOKE DOORS
	Resolution:	Issue was resolved prior to completion of inspection
	Resolved By:	Christopher Kirkbride
	Resolved On:	06/11/2025
	Manufacturer:	NOTIFIER
	Model:	Fsp-851t
Smoke Detector - General	N001 L08D011	F MED PIPE CHASE
	Created By:	Chase Buchanan
	Creation Date:	06/12/2025

EQUIPMENT TYPE	ADDRESS	DESCRIPTION
----------------	---------	-------------

Corrective Action: Change description in panel to FMH PIPE CHASE  
 Resolution: Dup  
 Resolved By: Chase Buchanan  
 Resolved On: 06/12/2025  
 Manufacturer: NOTIFIER  
 Model: SDX-551, FSP-851, FSP-951IV

N/A	General General	N/A
-----	--------------------	-----

Created By: Christopher Kirkbride  
 Creation Date: 06/12/2025  
 Corrective Action: Annunciator in B Tower failed to operate  
 Resolution: Duplicated CA  
 Resolved By: Christopher Kirkbride  
 Resolved On: 06/13/2025  
 Manufacturer:  
 Model:

Created By: Christopher Kirkbride  
 Creation Date: 06/12/2025  
 Corrective Action: Annunciator in E pod control tower shows communication fault  
 Resolution: Duplicated CA  
 Resolved By: Christopher Kirkbride  
 Resolved On: 06/13/2025  
 Manufacturer:  
 Model:



Created By: Christopher Kirkbride  
 Creation Date: 06/12/2025  
 Corrective Action: Annunciator in F pod control tower did not work  
 Resolution: Duplicated CA  
 Resolved By: Christopher Kirkbride  
 Resolved On: 06/13/2025  
 Manufacturer:  
 Model:

Created By: Chase Buchanan  
 Creation Date: 06/13/2025  
 Corrective Action: Annunciator in H pod tower not working  
 Resolution: Duplicated CA  
 Resolved By: Christopher Kirkbride  
 Resolved On: 06/13/2025  
 Manufacturer:  
 Model:

# Testing Details

## Emergency Communication Equipment

Passed

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Bi-Directional Amplifier		Bio directional amplifier inside of FACP room	Manual	6/11/2025 8:57:35 AM

Comment: Did not test BDA system



Manufacturer	Advanced rf technology
Visual Inspection	Passed (Manual)
Functional Inspection	Passed
Active components shall be checked to verify operation within the manufacturer's published specifications	NA
BDA alarm log checked for recurring or substantial alarm conditions	NA
BDA is supervised by FAS	No
Downlink amplifier gain matches gain values recorded at commissioning plus or minus 2 db.	NA
Downlink signal strength received at input to BDA meet original commissioning values plus or minus 2dB	NA
Uplink amplifier gain matches gain at commissioning plus or minus 2 db.	NA
Verified spurious oscillations are not being generated by the subject BDA	NA
Verified that Isolation between Donor and DAS is >20dB	NA

## Emergency Control Equipment

Passed

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Elevator Recall - Alternate	N001 L05M002	Elevator alternate recall	Manual	6/9/2025 11:22:13 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Elevator Recall - Primary	N001 L05M003	Primary elevator recall	Manual	6/9/2025 11:24:12 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L06M012	G Block fan control	Manual	6/10/2025 9:06:37 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L06M013	G Block fan control	Manual	6/10/2025 9:07:22 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L06M014	G Block fan control	Manual	6/10/2025 9:07:56 AM
		Visual Inspection	Passed (Manual)	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Functional Inspection	Passed	
Fan Control	N001 L06M015	G Block fan control	Manual	6/10/2025 9:08:31 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L06M016	G Block fan control	Manual	6/10/2025 9:09:01 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L06M017	G Block fan control	Manual	6/10/2025 9:09:34 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L06M018	G Block fan control	Manual	6/10/2025 9:10:02 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
HVAC Shutdown	N001 L06M019	G block HVAC shut down	Manual	6/10/2025 9:10:56 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
HVAC Shutdown	N001 L07M013	AHU F shut down	Manual	6/10/2025 9:13:22 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L07M014	AHU F FAN CONTROL	Manual	6/10/2025 9:14:35 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L07M015	AHU f fan control	Manual	6/10/2025 9:15:47 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L07M016	AHU F fan control	Manual	6/10/2025 9:18:22 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L07M017	AHU F fan control	Manual	6/10/2025 9:19:12 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L07M018	AHU F fan control	Manual	6/10/2025 9:20:13 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
HVAC Shutdown	N001 L08M017	AHU H shutdown	Manual	6/10/2025 9:35:53 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
HVAC Shutdown	N001 L08M018	AHU H shutdown	Manual	6/10/2025 9:36:32 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L08M019	AHU H fan control	Manual	6/10/2025 9:37:28 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L08M020	AHU H fan control	Manual	6/10/2025 9:38:07 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L08M021	AHU H fan control	Manual	6/10/2025 9:38:44 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Door Control Relay	N001 L08M022	Door control relay	Manual	6/10/2025 9:39:49 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
HVAC Shutdown	N001 L01M093	Pod D shut down	Manual	6/11/2025 9:45:17 AM
		Visual Inspection	Passed (Manual)	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Functional Inspection	Passed	
Fan Control	N001 L01M094	Pod D fan control	Manual	6/11/2025 9:45:38 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L02M001	Pod B fan control	Manual	6/11/2025 9:46:15 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L03M002	Pod C fan control	Manual	6/11/2025 9:46:56 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L05M016	Pod E fan control	Manual	6/11/2025 9:47:25 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Door Control Relay	N001 L08M023	Door holders, FC corridor	Manual	6/11/2025 9:50:56 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N005 L01M011	TRIP FROM WATERFLOW	Manual	6/11/2025 2:39:47 PM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Fan Control	N001 L01M001	Pod A Fan Control	Manual	6/13/2025 9:48:29 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Door Control Relay	N001 L01M002 L01M002	Pod A Door Release	Manual	6/13/2025 9:48:32 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Door Holder Release	N001 L01M099	DOOR RELEASE	Manual	6/13/2025 10:01:29 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Door Holder Release	N001 L03M003	POD C DOOR RELEASE	Manual	6/13/2025 10:02:09 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Door Holder Release	N001 L05M017	POD E DOOR RELEASE	Manual	6/13/2025 10:04:16 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Skipped				
EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
[Other]	N001 L07M019	Antifreeze system	Manual	6/10/2025 9:34:05 AM
Failed				
EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
[Other]	N001 L01M091	Module L01M091	Manual	6/12/2025 8:45:20 AM
		Functional Inspection	Failed	
[Other]	N001 L01M092	Module L01M092	Manual	6/12/2025 8:45:47 AM
		Functional Inspection	Failed	
[Other]	N001 L01M095	Module L01M095	Manual	6/13/2025 9:53:10 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L01M096	Module L01M096	Manual	6/13/2025 9:53:53 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L01M097	Module L01M097	Manual	6/13/2025 10:00:52 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L01M098	Module L01M098	Manual	6/13/2025 10:01:21 AM

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L02M002	Module L02M002	Manual	6/13/2025 10:01:44 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L04M001	Module L04M001	Manual	6/13/2025 10:02:44 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L04M014	Module L04M014	Manual	6/13/2025 10:03:00 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L04M002	Module L04M002	Manual	6/13/2025 10:03:21 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L05M032	Module L05M032	Manual	6/13/2025 10:04:49 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L05M060	Module L05M060	Manual	6/13/2025 10:05:51 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L05M061	Module L05M061	Manual	6/13/2025 10:06:10 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L05M062	Module L05M062	Manual	6/13/2025 10:06:39 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L05M070	Module L05M070	Manual	6/13/2025 10:07:09 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L05M073	Module L05M073	Manual	6/13/2025 10:07:44 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	

**Fire Control Panel**


Passed

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Fire Alarm Panel	N001 N001	main FACP in main telco room	Manual	6/9/2025 9:48:05 AM



Manufacturer	NOTIFIER
Model	NFS 3030
Visual Inspection	Passed (Manual)
Functional Inspection	Passed

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Fire Alarm Panel	N005 N005	Sub FACP panel in I pod	Manual	6/9/2025 9:48:38 AM

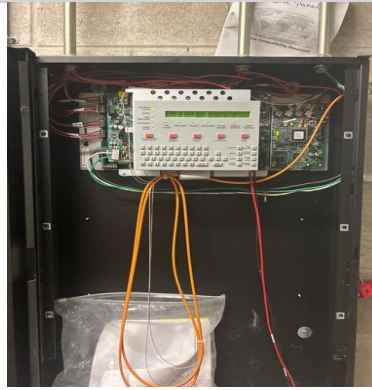

Manufacturer NOTIFIER  
 Model NFS 320  
 Visual Inspection Passed (Manual)  
 Functional Inspection Passed

Remote Annunciator		Booking control I Pod	Manual	6/11/2025 2:38:28 PM
--------------------	--	-----------------------	--------	----------------------

Manufacturer NOTIFIER  
 Model LCD-80  
 Visual Inspection Passed (Manual)  
 Functional Inspection Passed

Remote Annunciator		Booking control room, G Pod	Manual	6/13/2025 10:53:35 AM
--------------------	--	-----------------------------	--------	-----------------------

Manufacturer NOTIFIER  
 Model LCD-80  
 Visual Inspection Passed (Manual)  
 Functional Inspection Passed

Remote Annunciator		Booking control room, C Pod	Manual	6/13/2025 10:53:39 AM
--------------------	--	-----------------------------	--------	-----------------------

Manufacturer NOTIFIER  
 Model LCD-80  
 Visual Inspection Passed (Manual)  
 Functional Inspection Passed

Failed

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Remote Annunciator		Booking control room, A Pod	Manual	6/11/2025 9:43:38 AM

Manufacturer NOTIFIER  
 Model LCD-80  
 Functional Inspection Failed

Remote Annunciator		Booking control room, E Pod	Manual	6/13/2025 10:57:58 AM
--------------------	--	-----------------------------	--------	-----------------------

Manufacturer NOTIFIER  
 Model LCD-80  
 Visual Inspection Failed (Manual)  
 Functional Inspection Failed

Remote Annunciator		Booking control room, H Pod	Manual	6/13/2025 10:58:50 AM
--------------------	--	-----------------------------	--------	-----------------------

Manufacturer NOTIFIER  
 Model LCD-80  
 Visual Inspection Failed (Manual)  
 Functional Inspection Failed

Remote Annunciator		Booking control room, F Pod	Manual	6/13/2025 10:59:25 AM
--------------------	--	-----------------------------	--------	-----------------------

Manufacturer NOTIFIER  
 Model LCD-80  
 Visual Inspection Failed (Manual)  
 Functional Inspection Failed

Remote Annunciator		Booking control room, B Pod	Manual	6/13/2025 11:00:00 AM
--------------------	--	-----------------------------	--------	-----------------------

Manufacturer NOTIFIER  
 Model LCD-80  
 Visual Inspection Failed (Manual)  
 Functional Inspection Failed

## Initiating Device

Passed

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Smoke Detector - General	N001 L05D012	Mechanical rm E085	Manual	6/9/2025 8:46:09 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection Functional Inspection	Passed (Manual) Passed	
Smoke Detector - General	N001 L05D013	Mechanical rm E085	Manual	6/9/2025 8:47:51 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection Functional Inspection	Passed (Manual) Passed	
Smoke Detector - General	N001 L05D068	Mechanical rm 058	Manual	6/9/2025 8:54:44 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection Functional Inspection	Passed (Manual) Passed	
Smoke Detector - General	N001 L05D021	Mechanical rm 058	Manual	6/9/2025 8:56:20 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection Functional Inspection	Passed (Manual) Passed	
Smoke Detector - General	N001 L04D054	janitors closet P082 smoke	Manual	6/9/2025 8:59:36 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection Functional Inspection	Passed (Manual) Passed	
Smoke Detector - General	N001 L05D009	File storage rm E113	Manual	6/9/2025 9:01:45 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection Functional Inspection	Passed (Manual) Passed	
Smoke Detector - General	N001 L05D010	Admin Area Over Receptionist Desk	Manual	6/9/2025 9:02:46 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection Functional Inspection	Passed (Manual) Passed	
[Other]	N001 L05M009	Jail Admin Lobby	Manual	6/9/2025 9:04:14 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection Functional Inspection	Passed (Manual) Passed	
Smoke Detector - General	N001 L01D098	Lobby Corridor Smoke	Manual	6/9/2025 9:19:23 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection Functional Inspection	Passed (Manual) Passed	
Smoke Detector - General	N001 L04D098	Sargents Office	Manual	6/9/2025 9:23:35 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D097	Armory	Manual	6/9/2025 9:24:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D099	Lobby Corridor	Manual	6/9/2025 9:25:54 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D091	POD D COMMON AREA	Manual	6/9/2025 9:26:35 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D092	Corridor Outside Kitchen	Manual	6/9/2025 9:27:12 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D093	Corridor Outside Kitchen	Manual	6/9/2025 9:29:24 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D094	Corridor Outside Dining Hall	Manual	6/9/2025 9:31:11 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L04M003	Staff D hall	Manual	6/9/2025 9:31:51 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Heat Detector - Restorable Spot	N001 L04D018	Kitchen	Manual	6/9/2025 9:32:58 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Alarm Sensitivity	Fixed	
Heat Detector - Restorable Spot	N001 L04D019	Kitchen	Manual	6/9/2025 9:33:34 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Alarm Sensitivity	Fixed	
Heat Detector - Restorable Spot	N001 L04D007	Kitchen	Manual	6/9/2025 9:34:28 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Alarm Sensitivity	Fixed	
Heat Detector - Restorable Spot	N001 L04D004	Kitchen	Manual	6/9/2025 9:35:25 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Alarm Sensitivity	Fixed	
Smoke Detector - General	N001 L04D001	hazardous Chem storage kitchen	Manual	6/9/2025 9:36:37 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D003	kitchen storage	Manual	6/9/2025 9:39:37 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D002	kitchen storage smoke	Manual	6/9/2025 10:36:43 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D005	Loading Dock Storage	Manual	6/9/2025 10:39:09 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D023	WAREHOUSE	Manual	6/9/2025 10:40:18 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D022	WAREHOUSE	Manual	6/9/2025 10:42:20 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D021	WAREHOUSE	Manual	6/9/2025 10:43:33 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D026	WAREHOUSE	Manual	6/9/2025 10:43:58 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D024	WAREHOUSE	Manual	6/9/2025 10:47:26 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Heat Detector - Restorable Spot	N001 L04D027	CENTRAL PLANT	Manual	6/9/2025 10:50:40 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Alarm Sensitivity	Fixed	
Heat Detector - Restorable Spot	N001 L04D030	CENTRAL PLANT	Manual	6/9/2025 10:51:51 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Alarm Sensitivity	Fixed	
Heat Detector - Restorable Spot	N001 L04D029	CENTRAL PLANT	Manual	6/9/2025 10:53:39 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Alarm Sensitivity	Fixed	
Heat Detector - Restorable Spot	N001 L04D028	CENTRAL PLANT	Manual	6/9/2025 10:54:16 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Alarm Sensitivity	Fixed	
Smoke Detector - General	N001 L04D044	COMMON AREA POD D	Manual	6/9/2025 10:54:59 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D043	COMMON AREA POD D	Manual	6/9/2025 10:55:45 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D011	laundry smoke	Manual	6/9/2025 10:56:18 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D015	JANITOR LAUNDRY	Manual	6/9/2025 10:57:08 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L01M031	Central control	Manual	6/9/2025 11:06:32 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D062	CENTRAL HALL CORRIDOR	Manual	6/9/2025 11:10:52 AM

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L05M005	ADMIN HEARING RM	Manual	6/9/2025 11:12:46 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D003	mechanical rm E088	Manual	6/9/2025 11:18:52 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D005	BOOKING I POD	Manual	6/9/2025 11:19:16 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D022	mechanical rm E088	Manual	6/9/2025 11:20:19 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D006	mechanical rm E088	Manual	6/9/2025 11:20:44 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D002	BOOKING I POD	Manual	6/9/2025 11:21:23 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D097	1st fl elevator lobby	Manual	6/9/2025 11:25:04 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D070	2nd fl elevator lobby	Manual	6/9/2025 11:26:12 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L01M015	2nd fl elevator lobby	Manual	6/9/2025 11:26:55 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D075	2nd fl corridor	Manual	6/9/2025 11:27:33 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D090	2nd fl corridor Area E	Manual	6/9/2025 11:28:00 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D074	2nd fl corridor	Manual	6/9/2025 11:28:23 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D073	2nd fl corridor	Manual	6/9/2025 11:28:43 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D079	2nd fl corridor	Manual	6/9/2025 11:29:02 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D081	2nd fl corridor	Manual	6/9/2025 11:31:41 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D080	2nd fl sprinkler closet	Manual	6/9/2025 11:32:10 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D083	2nd fl corridor at smoke doors	Manual	6/9/2025 11:33:11 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D085	2nd fl corridor at smoke doors	Manual	6/9/2025 11:33:47 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D072	2nd floor corridor	Manual	6/9/2025 11:34:12 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D071	2nd floor corridor outside visitation B	Manual	6/9/2025 11:34:48 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D069	2nd floor corridor	Manual	6/9/2025 11:35:08 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D067	2nd floor corridor	Manual	6/9/2025 11:38:28 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D066	2nd floor corridor	Manual	6/9/2025 11:38:50 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D013	2nd floor corridor at smoke doors	Manual	6/9/2025 11:39:21 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D086	2nd floor corridor at smoke doors	Manual	6/9/2025 11:39:44 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D065	2nd floor corridor	Manual	6/9/2025 11:40:10 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D064	Outside visitation a	Manual	6/9/2025 11:40:58 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L01M008	Outside visitation a	Manual	6/9/2025 11:43:22 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L01M009	Mechanical room a 245	Manual	6/9/2025 11:44:16 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D054	Mechanical room a 245	Manual	6/9/2025 11:45:02 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D051	Mechanical room a 245	Manual	6/9/2025 11:45:21 AM

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D052	Mechanical room a 245	Manual	6/9/2025 11:45:40 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D053	Mechanical room a 245	Manual	6/9/2025 11:45:55 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D089	2nd floor IT room	Manual	6/9/2025 11:46:38 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D053	Mechanical room B246	Manual	6/9/2025 11:48:00 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L05M014	Mechanical room E058	Manual	6/10/2025 9:03:20 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Supervisory - Control Valve	N001 L05M015	Mechanical room E058	Manual	6/10/2025 9:17:14 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Supervisory - Control Valve	N001 L03M030	Mechanical room, C	Manual	6/10/2025 9:25:28 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Supervisory - Control Valve	N001 L01M020	Riser closet on second floor corridor	Manual	6/10/2025 10:02:15 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L01M019	Riser closet on second floor corridor	Manual	6/10/2025 10:03:27 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L01M075	dpod corridor sliders	Manual	6/10/2025 10:22:40 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Supervisory - Control Valve	N001 L01M022	Second floor corridor, sprinkler closet over kitchen	Manual	6/10/2025 10:26:14 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L01M021	Second floor corridor, sprinkler closet	Manual	6/10/2025 10:26:55 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Supervisory - Control Valve	N001 L01M018	Tamper in ceiling in visitation E	Manual	6/10/2025 10:31:40 AM

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L01M017	Water flow in ceiling in visitation E	Manual	6/10/2025 10:33:02 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D052	Mechanical room B246	Manual	6/10/2025 11:17:05 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D051	Mechanical room B246	Manual	6/10/2025 11:17:45 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D050	Mechanical room B246 2nd floor	Manual	6/10/2025 11:18:13 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L01M012	MECHANICAL RM POD B	Manual	6/10/2025 11:18:36 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D045	Mechanical rm C246	Manual	6/10/2025 11:19:44 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D048	Mechanical rm C246	Manual	6/10/2025 11:20:11 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Supervisory - Control Valve	N001 L02M030	Mechanical room B246	Manual	6/10/2025 11:21:50 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D046	Mechanical rm C246	Manual	6/10/2025 11:21:55 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D047	Mechanical rm C246	Manual	6/10/2025 11:22:37 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L01M007	Mechanical rm C246	Manual	6/10/2025 11:23:51 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Functional Inspection	Passed	
Supervisory - High/Low Air Pressure Switch	N1.L2.M30(2)	Mechanical room B246	Manual	6/10/2025 11:25:34 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D059	2ND FL FILES RM	Manual	6/10/2025 11:26:01 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D061	1ST FL CORRIDOR OUTSIDE STORAGE	Manual	6/10/2025 11:27:25 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D087	CORRIDOR OUTSIDE B POD	Manual	6/10/2025 11:28:07 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D060	CORRIDOR OUTSIDE C POD	Manual	6/10/2025 11:28:34 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D059	CORRIDOR D HALL	Manual	6/10/2025 11:29:21 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D058	CORRIDOR D HALL	Manual	6/10/2025 11:29:46 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D088	CORRIDOR D HALL AT SMOKE DOOR	Manual	6/10/2025 11:30:32 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D057	CORRIDOR D HALL AT SMOKE DOOR	Manual	6/10/2025 11:30:56 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D056	CORRIDOR D HALL	Manual	6/10/2025 11:31:33 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D055	CENTRAL HALL CORRIDOR POD A	Manual	6/10/2025 11:32:04 AM

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L06M006	D HALL CORRIDOR EXIT	Manual	6/10/2025 11:34:08 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Heat Detector - Restorable Spot	N001 L06D073	MECHANICAL RM D HALL CORRIDOR	Manual	6/10/2025 11:35:10 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Alarm Sensitivity	Fixed	
Smoke Detector - General	N001 L06D074	MECHANICAL RM D HALL CORRIDOR	Manual	6/10/2025 11:36:26 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D049	COMMON AREA POD D	Manual	6/10/2025 11:41:54 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D050	COMMON AREA POD D	Manual	6/10/2025 11:43:20 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D051	COMMON AREA POD D	Manual	6/10/2025 11:43:38 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D099	E POD MECHANICAL RM	Manual	6/10/2025 11:44:12 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D038	E POD MECHANICAL RM	Manual	6/10/2025 11:44:38 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D131	HOSPITAL CORRIDOR	Manual	6/10/2025 11:47:51 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D130	HOSPITAL CORRIDOR	Manual	6/10/2025 11:48:21 AM

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L07M001	POD F DATA RM	Manual	6/10/2025 11:49:10 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Heat Detector - Restorable Spot	N001 L07D001	POD F DATA RM	Manual	6/10/2025 11:50:34 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Alarm Sensitivity	Fixed	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L01M016	2nd floor paper storage	Manual	6/10/2025 11:52:56 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D054	POD F DATA RM	Manual	6/10/2025 11:53:00 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Heat Detector - Restorable Spot	N001 L07D052	POD F DATA RM	Manual	6/10/2025 11:53:26 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Alarm Sensitivity	Fixed	
Manual Fire Box	N001 L08M051	ROLL CALL RM	Manual	6/10/2025 11:54:14 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D095	RECEPTION JANITORS CLOSET	Manual	6/10/2025 11:55:27 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D063	D HALL FOOD STORAGE RM	Manual	6/10/2025 11:56:28 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D065	D HALL STORAGE RM	Manual	6/10/2025 11:56:49 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L06M005	D HALL EXIT	Manual	6/10/2025 11:57:51 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Functional Inspection	Passed	
[Other]	N001 L05M050	E POD CONTROL TOWER	Manual	6/10/2025 11:59:13 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L08M015	MEDICAL RECEPTIONS DESK	Manual	6/10/2025 12:01:18 PM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L08M004	MEDICAL RECEPTIONS DESK	Manual	6/10/2025 12:01:45 PM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector	N001 L08M001	CORRIDOR BY MEDICAL	Manual	6/10/2025 1:29:05 PM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L08M055	FC CHILLER ROOM RISER F	Manual	6/10/2025 1:30:31 PM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L08M003	MEDICAL EMERGENCY EXIT SALLYPORT	Manual	6/10/2025 1:30:32 PM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D026	MECHANICAL RM H POD PIPE CHASE	Manual	6/10/2025 1:33:14 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D023	MECHANICAL RM H POD PIPE CHASE	Manual	6/10/2025 1:33:40 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L08M006	MECHANICAL RM H POD PIPE CHASE	Manual	6/10/2025 1:34:41 PM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L08M036	fc chiller room riser I	Manual	6/10/2025 1:35:58 PM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D002	MECHANICAL RM H POD PIPE CHASE	Manual	6/10/2025 1:36:07 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D003	MECHANICAL RM H POD PIPE CHASE	Manual	6/10/2025 1:36:50 PM

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D005	MECHANICAL RM H POD PIPE CHASE	Manual	6/10/2025 1:37:05 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D004	MECHANICAL RM H POD PIPE CHASE	Manual	6/10/2025 1:37:21 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D001	IT room by FC corridor	Manual	6/10/2025 1:38:23 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L08M005	outside mechanical slider	Manual	6/10/2025 1:39:30 PM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L08M016	H pod tower	Manual	6/10/2025 1:40:28 PM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L08M052	FC chiller room exit	Manual	6/10/2025 1:53:48 PM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Supervisory - Control Valve	N001 L04M020	Tamper in back warehouse, D-Block	Manual	6/11/2025 9:27:13 AM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L07M011	Pod E exit to FC corridor	Manual	6/11/2025 9:48:00 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L07M005	Pod F North stair exit	Manual	6/11/2025 9:48:24 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L08M012	Pod H Sally Port	Manual	6/11/2025 9:49:44 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Supervisory - Control Valve	N001 L05M020	tamper above E pod control tower	Manual	6/11/2025 10:27:08 AM
		Visual Inspection	Passed (Manual)	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D029	MECHANICAL 1201	Manual	6/11/2025 1:58:44 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - Duct	N005 L01D027	MECHANICAL 1201	Manual	6/11/2025 2:00:44 PM
		Manufacturer	System sensor	
		Model	DNR/851R	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - Duct	N005 L01D028	MECHANICAL 1201	Manual	6/11/2025 2:01:23 PM
		Manufacturer	NOTIFIER	
		Model	DNR/851R	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N005 L01M012	TRIP FROM WATERFLOW	Manual	6/11/2025 2:07:53 PM
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N005 L01M005	SALLYPORT 1103	Manual	6/11/2025 2:09:55 PM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D012	INMATE CORRIDOR 1085	Manual	6/11/2025 2:12:40 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D023	INMATE CORRIDOR 1085	Manual	6/11/2025 2:13:54 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D025	INMATE CORRIDOR 1085	Manual	6/11/2025 2:17:12 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D017	INMATE CORRIDOR 1008	Manual	6/11/2025 2:23:09 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D016	INMATE CORRIDOR 1008	Manual	6/11/2025 2:23:48 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D015	CORRIDOR 1024	Manual	6/11/2025 2:25:31 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D013	CORRIDOR 1024	Manual	6/11/2025 2:27:12 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D022	FINGERPRINT AND I.D.	Manual	6/11/2025 2:28:07 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D011	FINGERPRINT AND I.D.	Manual	6/11/2025 2:29:03 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D010	CORRIDOR 1030	Manual	6/11/2025 2:29:28 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N005 L01M003	SALLYPORT 1037	Manual	6/11/2025 2:30:46 PM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D009	PRE-BOOKING	Manual	6/11/2025 2:31:09 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-951t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D007	OFFICER WRITE UP	Manual	6/11/2025 2:31:38 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D008	METAL DETECTOR	Manual	6/11/2025 2:31:56 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N005 L01M002	SALLYPORT 1042	Manual	6/11/2025 2:32:21 PM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D006	FORMS	Manual	6/11/2025 2:33:06 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D005	CORRIDOR 1052	Manual	6/11/2025 2:33:52 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D004	CORRIDOR 1060	Manual	6/11/2025 2:34:27 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Smoke Detector - General	N005 L01D003	CORRIDOR 1060	Manual	6/11/2025 2:34:51 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D002	CORRIDOR 1060	Manual	6/11/2025 2:35:45 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D001	INMATE VESTIBULE	Manual	6/11/2025 2:36:45 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D031	COMMUNICATIONS ROOM	Manual	6/11/2025 2:37:19 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N005 L01M001	RELEASE CONTROL	Manual	6/11/2025 2:40:05 PM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D018	MECHANICAL HALLWAY	Manual	6/11/2025 2:42:11 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D019	MECHANICAL HALLWAY	Manual	6/11/2025 2:42:25 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D020	MECHANICAL HALLWAY	Manual	6/11/2025 2:42:39 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D030	TELE/DATA RM 1007	Manual	6/11/2025 2:42:54 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D021	MECHANICAL HALLWAY	Manual	6/11/2025 2:43:58 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N005 L01D014	CORRIDOR 1024	Manual	6/11/2025 2:44:16 PM
		Manufacturer	NOTIFIER	
		Model	Fsp-851t	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N005 L01M004	SALLYPORT 1102	Manual	6/11/2025 2:55:44 PM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Heat Detector - Restorable Spot	N001 L06D075	D HALL MECHANICAL RM	Manual	6/12/2025 9:04:04 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Alarm Sensitivity	Fixed	
Manual Fire Box	N001 L08M008	MMH PIPE CHASE	Manual	6/12/2025 9:13:51 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D022	MMH PIPE CHASE	Manual	6/12/2025 9:14:14 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D021	MMH PIPE CHASE	Manual	6/12/2025 9:15:11 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D020	MMH PIPE CHASE	Manual	6/12/2025 9:16:16 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L08M009	MMH PIPE CHASE	Manual	6/12/2025 9:17:35 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L08M010	MMH PIPE CHASE	Manual	6/12/2025 9:18:37 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D019	MMH PIPE CHASE	Manual	6/12/2025 9:19:14 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D018	MMH PIPE CHASE	Manual	6/12/2025 9:19:36 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D017	FMH PIPE CHASE	Manual	6/12/2025 9:20:21 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Functional Inspection	Passed	
Manual Fire Box	N001 L08M011	FMH PIPE CHASE	Manual	6/12/2025 9:22:19 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D016	FMH PIPE CHASE	Manual	6/12/2025 9:23:11 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D014	FMH PIPE CHASE	Manual	6/12/2025 9:24:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L08M013	F MED PIPE CHASE	Manual	6/12/2025 9:26:06 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D013	F MED PIPE CHASE	Manual	6/12/2025 9:27:26 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D012	F MED PIPE CHASE	Manual	6/12/2025 9:27:46 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D011	F MED PIPE CHASE	Manual	6/12/2025 9:28:37 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D010	F MED PIPE CHASE	Manual	6/12/2025 9:29:03 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D009	M MED PIPE CHASE	Manual	6/12/2025 9:29:30 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D008	M MED PIPE CHASE	Manual	6/12/2025 9:29:48 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D007	M MED PIPE CHASE	Manual	6/12/2025 9:30:05 AM

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L08D006	M MED PIPE CHASE	Manual	6/12/2025 9:31:05 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L08M014	M MED PIPE CHASE	Manual	6/12/2025 9:31:32 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L07M009	FA PIPE CHASE	Manual	6/12/2025 9:32:38 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D021	FA PIPE CHASE	Manual	6/12/2025 9:33:04 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D020	FB PIPE CHASE	Manual	6/12/2025 9:33:36 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D019	FA PIPE CHASE	Manual	6/12/2025 9:34:05 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D018	FB PIPE CHASE	Manual	6/12/2025 9:35:08 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D017	FB PIPE CHASE	Manual	6/12/2025 9:35:47 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L07M008	FC PIPE CHASE EXIT #1	Manual	6/12/2025 9:36:55 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D014	FC PIPE CHASE	Manual	6/12/2025 9:38:39 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D013	FC PIPE CHASE	Manual	6/12/2025 9:39:20 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L07M002	FC PIPE CHASE EXIT BOILER RM	Manual	6/12/2025 9:42:16 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L07M007	FC PIPE CHASE EXIT 2	Manual	6/12/2025 9:44:30 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L07M006	Pod F North exit	Manual	6/12/2025 9:45:45 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L07M004	FD PIPE CHASE EXIT	Manual	6/12/2025 9:46:36 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D011	FD PIPE CHASE	Manual	6/12/2025 9:47:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D010	FD PIPE CHASE	Manual	6/12/2025 9:47:49 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D009	FD PIPE CHASE	Manual	6/12/2025 9:48:09 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D008	FD PIPE CHASE	Manual	6/12/2025 9:49:58 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L07M003	FD PIPE CHASE EXIT 2	Manual	6/12/2025 9:51:25 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D007	FE PIPE CHASE	Manual	6/12/2025 9:52:40 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D006	FE PIPE CHASE	Manual	6/12/2025 9:52:58 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D005	FE PIPE CHASE	Manual	6/12/2025 9:53:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D004	FF PIPE CHASE	Manual	6/12/2025 9:53:33 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D003	FF PIPE CHASE	Manual	6/12/2025 9:54:07 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L07D002	FF PIPE CHASE	Manual	6/12/2025 9:54:43 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L06M007	GA PIPE CHASE	Manual	6/12/2025 9:57:22 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D013	GA PIPE CHASE	Manual	6/12/2025 9:57:47 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D014	GA PIPE CHASE	Manual	6/12/2025 9:58:02 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D015	GA PIPE CHASE	Manual	6/12/2025 9:59:02 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D016	GA PIPE CHASE	Manual	6/12/2025 9:59:19 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D017	GB PIPE CHASE	Manual	6/12/2025 9:59:44 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D018	GB PIPE CHASE	Manual	6/12/2025 9:59:58 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D019	GB PIPE CHASE	Manual	6/12/2025 10:00:13 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L06M008	GA PIPE CHASE	Manual	6/12/2025 10:01:02 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D020	GA PIPE CHASE	Manual	6/12/2025 10:01:33 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D023	GB PIPE CHASE	Manual	6/12/2025 10:02:01 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D022	GC PIPE CHASE	Manual	6/12/2025 10:02:28 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D021	GC PIPE CHASE	Manual	6/12/2025 10:02:45 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L06M009	GC PIPE CHASE	Manual	6/12/2025 10:03:22 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D024	GC PIPE CHASE	Manual	6/12/2025 10:03:41 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Manual Fire Box	N001 L06M002	GD PIPE CHASE EXIT	Manual	6/12/2025 10:04:41 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D001	GD PIPE CHASE	Manual	6/12/2025 10:05:07 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D002	GD PIPE CHASE	Manual	6/12/2025 10:05:25 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D004	GD PIPE CHASE	Manual	6/12/2025 10:06:00 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D005	GD PIPE CHASE	Manual	6/12/2025 10:06:18 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L06M003	GE PIPE CHASE EXIT	Manual	6/12/2025 10:07:03 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D006	GE PIPE CHASE	Manual	6/12/2025 10:08:04 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D007	GF PIPE CHASE	Manual	6/12/2025 10:08:22 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D008	GF PIPE CHASE	Manual	6/12/2025 10:08:41 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D011	GF PIPE CHASE	Manual	6/12/2025 10:09:39 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L06M004	GF PIPE CHASE EXIT	Manual	6/12/2025 10:10:10 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L06D012	GF PIPE CHASE	Manual	6/12/2025 10:10:30 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L06M011	POD G CONTROL TOWER	Manual	6/12/2025 10:13:41 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L06M001	POD G SOUTH EXIT	Manual	6/12/2025 10:15:27 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D007	COMMON AREA POD B SALLY PORT	Manual	6/12/2025 11:12:33 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D008	COMMISSARY POD B	Manual	6/12/2025 11:13:28 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D006	B POD SALLY PORT	Manual	6/12/2025 11:17:11 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D049	COMMON AREA POD B	Manual	6/12/2025 11:18:10 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D048	COMMON AREA POD B	Manual	6/12/2025 11:18:26 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D047	COMMON AREA POD B	Manual	6/12/2025 11:18:38 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D046	COMMON AREA POD B	Manual	6/12/2025 11:18:51 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D045	COMMON AREA POD B	Manual	6/12/2025 11:19:03 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D034	DAY ROOM B POD AREA F	Manual	6/12/2025 11:19:19 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D033	DAY ROOM B POD AREA F	Manual	6/12/2025 11:19:29 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D036	DAY ROOM B POD AREA E	Manual	6/12/2025 11:19:51 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D037	DAY ROOM B POD AREA D	Manual	6/12/2025 11:21:19 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D039	DAY ROOM B POD AREA C	Manual	6/12/2025 11:23:11 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D040	DAY ROOM B POD AREA C	Manual	6/12/2025 11:24:27 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D042	DAY ROOM B POD AREA B	Manual	6/12/2025 11:26:43 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D041	DAY ROOM B POD AREA B	Manual	6/12/2025 11:27:39 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D043	B POD AREA A	Manual	6/12/2025 11:29:23 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Smoke Detector - General	N001 L02D044	B POD AREA A	Manual	6/12/2025 11:30:12 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L02M006	POD B TOWER PULL STATION	Manual	6/12/2025 11:33:28 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D001	CONTROL TOWER POD B	Manual	6/12/2025 11:34:28 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D002	CONTROL TOWER POD B	Manual	6/12/2025 11:34:37 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D003	CONTROL TOWER POD B	Manual	6/12/2025 11:35:18 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D004	STORAGE ACROSS MEDICAL POD B	Manual	6/12/2025 11:36:52 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D005	STORAGE ACROSS MEDICAL POD B	Manual	6/12/2025 11:37:10 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D009	STORAGE ACROSS MEDICAL POD B	Manual	6/12/2025 11:37:47 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D009	STORAGE POD C	Manual	6/12/2025 11:38:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D008	COMMON AREA POD C	Manual	6/12/2025 11:39:24 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D006	JANITORS CLOSET POD C	Manual	6/12/2025 11:40:27 AM

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D007	SUPERVISORS OFFICE POD C	Manual	6/12/2025 11:42:09 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D049	COMMON AREA POD C	Manual	6/12/2025 11:42:32 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D050	COMMON AREA POD C	Manual	6/12/2025 11:42:45 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D051	COMMON AREA POD C	Manual	6/12/2025 11:42:53 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D052	COMMON AREA POD C	Manual	6/12/2025 11:43:04 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D001	CONTROL TOWER POD C	Manual	6/12/2025 11:46:03 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D002	CONTROL TOWER POD C	Manual	6/12/2025 11:46:44 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
[Other]	N001 L03M004	CONTROL TOWER POD C	Manual	6/12/2025 11:47:17 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D003	CONTROL TOWER POD C	Manual	6/12/2025 11:47:57 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D004	STORAGE RM C POD	Manual	6/12/2025 11:49:15 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D005	STORAGE RM C POD	Manual	6/12/2025 11:50:13 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D010	MEDICAL STORAGE C POD	Manual	6/12/2025 11:50:45 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D044	DAY ROOM C POD AREA F	Manual	6/12/2025 1:41:21 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D041	DAY ROOM C POD AREA E	Manual	6/12/2025 1:42:14 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D042	DAY ROOM C POD AREA E	Manual	6/12/2025 1:42:26 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D039	DAY ROOM C POD AREA D	Manual	6/12/2025 1:43:57 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D040	DAY ROOM C POD AREA D	Manual	6/12/2025 1:44:48 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D037	DAY ROOM C POD AREA C	Manual	6/12/2025 1:46:07 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D038	DAY ROOM C POD AREA C	Manual	6/12/2025 1:46:17 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D035	DAY ROOM C POD AREA B	Manual	6/12/2025 1:48:13 PM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D036	DAY ROOM C POD AREA B	Manual	6/12/2025 1:49:01 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D033	DAY ROOM C POD AREA A	Manual	6/12/2025 1:49:11 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L03D034	DAY ROOM C POD AREA A	Manual	6/12/2025 1:49:24 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D060	E POD MAIN CORRIDOR	Manual	6/12/2025 1:55:00 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D061	E POD MAIN CORRIDOR	Manual	6/12/2025 1:55:35 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D029	E POD TOWER BASEMENT	Manual	6/12/2025 1:57:16 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D030	E POD TOWER BASEMENT	Manual	6/12/2025 1:58:54 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D058	E POD E BLOCK	Manual	6/12/2025 2:10:04 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D059	E POD E BLOCK	Manual	6/12/2025 2:10:27 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D062	E POD CORRIDOR	Manual	6/12/2025 2:10:52 PM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D057	E POD BLOCK D DAY RM	Manual	6/12/2025 2:11:32 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D056	E POD BLOCK D DAY RM	Manual	6/12/2025 2:12:01 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D054	E POD C BLOCK DAY RM	Manual	6/12/2025 2:12:52 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D055	E POD C BLOCK DAY RM	Manual	6/12/2025 2:13:20 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D063	E POD CORRIDOR	Manual	6/12/2025 2:13:50 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D052	E POD B DAY RM	Manual	6/12/2025 2:14:24 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D051	E POD B DAY RM	Manual	6/12/2025 2:14:39 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D050	E POD A BLOCK DAY RM	Manual	6/12/2025 2:14:55 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D049	E POD A BLOCK DAY RM	Manual	6/12/2025 2:15:38 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L05D064	E POD MAIN CORRIDOR	Manual	6/12/2025 2:18:12 PM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Heat Detector - Restorable Spot	N001 L05D041	E POD B WATER HEATER RM	Manual	6/12/2025 2:18:42 PM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Alarm Sensitivity	Fixed	
Smoke Detector - General	N001 L05D053	E POD MAIN CORRIDOR	Manual	6/12/2025 2:19:11 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L07M010	SALLY PORT ACROSS FROM I POD	Manual	6/12/2025 2:21:15 PM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Manual Fire Box	N001 L07M012	POD F Control Tower	Manual	6/12/2025 2:32:38 PM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D033	T1 Day Rm	Manual	6/12/2025 2:41:47 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D032	T2 DAY RM	Manual	6/12/2025 2:42:54 PM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D078	2nd floor elevator lobby	Manual	6/13/2025 10:22:26 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L01D082	2nd floor corridor storage room d block	Manual	6/13/2025 10:23:21 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D009	Maintenance office	Manual	6/13/2025 10:25:53 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D008	Kitchen	Manual	6/13/2025 10:26:10 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D052	Laundry	Manual	6/13/2025 10:26:28 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D025	Warehouse	Manual	6/13/2025 10:28:13 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D017	Laundry storage	Manual	6/13/2025 10:28:29 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D020	Staff dining	Manual	6/13/2025 10:28:46 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D012	Laundry	Manual	6/13/2025 10:29:02 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L04D010	Laundry storage	Manual	6/13/2025 10:29:20 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Smoke Detector - General	N001 L02D054	janitors closet, pod b	Manual	6/13/2025 10:38:07 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	

Skipped

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
[Other]	N001 L08M034	Antifreeze system	Manual	6/10/2025 9:40:36 AM

Failed

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Heat Detector - Restorable Spot	N001 L04D014	Detector L04D014	Manual	6/9/2025 11:02:37 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Failed (Manual)	
		Alarm Sensitivity	Fixed	
Heat Detector - Restorable Spot	N001 L04D013	Detector L04D013	Manual	6/9/2025 11:04:00 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Failed (Manual)	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Alarm Sensitivity	Fixed	
Manual Fire Box	N005 L01M009	SALLYPORT 1075	Manual	6/11/2025 3:00:23 PM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D023	Detector L07D023	Manual	6/12/2025 8:33:50 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D029	Detector L07D029	Manual	6/12/2025 8:34:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L04D016	Detector L04D016	Manual	6/12/2025 8:34:35 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L04D034	Detector L04D034	Manual	6/12/2025 8:36:41 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L04D037	Detector L04D037	Manual	6/12/2025 8:36:54 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D012	Detector L07D012	Manual	6/12/2025 8:37:11 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D015	Detector L07D015	Manual	6/12/2025 8:37:23 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D046	Detector L01D046	Manual	6/12/2025 8:37:39 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D070	Detector L05D070	Manual	6/12/2025 8:37:53 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D072	Detector L05D072	Manual	6/12/2025 8:38:05 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Heat Detector - Restorable Spot	N001 L04D006	Detector L04D006	Manual	6/12/2025 8:38:23 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Functional Inspection	Failed	
		Alarm Sensitivity	Fixed	
Supervisory - Control Valve	N001 L01M023	Module L01M023	Manual	6/12/2025 8:39:06 AM
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D038	Detector L02D038	Manual	6/12/2025 8:39:40 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D022	Detector L07D022	Manual	6/12/2025 8:39:56 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D043	Detector L03D043	Manual	6/12/2025 8:40:56 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D031	Detector L03D031	Manual	6/12/2025 8:41:19 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D048	Detector L01D048	Manual	6/12/2025 8:41:41 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D049	Detector L06D049	Manual	6/12/2025 8:41:55 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D040	Detector L06D040	Manual	6/12/2025 8:43:33 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D042	Detector L06D042	Manual	6/12/2025 8:43:46 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D045	Detector L06D045	Manual	6/12/2025 8:44:02 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D015	Detector L08D015	Manual	6/12/2025 8:44:35 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D039	Detector L06D039	Manual	6/12/2025 8:44:51 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D065	Detector L06D065	Manual	6/12/2025 8:45:04 AM

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L04D096	Detector L04D096	Manual	6/12/2025 8:46:08 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
[Other]	N001 L08M056	Module L08M056	Manual	6/12/2025 8:46:22 AM
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D009	Detector L06D009	Manual	6/12/2025 8:46:38 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D001	Detector L01D001	Manual	6/13/2025 9:42:21 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D010	Detector L01D010	Manual	6/13/2025 9:42:42 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D011	Detector L01D011	Manual	6/13/2025 9:43:02 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L08M007	Module L08M007	Manual	6/13/2025 9:43:43 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L08M057	Module L08M057	Manual	6/13/2025 9:45:20 AM
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D012	Detector L01D012	Manual	6/13/2025 9:49:09 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D014	Detector L01D014	Manual	6/13/2025 9:51:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D015	Detector L01D015	Manual	6/13/2025 9:51:39 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D016	Detector L01D016	Manual	6/13/2025 9:52:00 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L01M006	Module L01M006	Manual	6/13/2025 9:52:32 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D017	Detector L01D017	Manual	6/13/2025 9:52:54 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D018	Detector L01D018	Manual	6/13/2025 9:53:11 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D019	Detector L01D019	Manual	6/13/2025 9:53:28 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D002	Detector L01D002	Manual	6/13/2025 9:53:43 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D099	Detector L08D099	Manual	6/13/2025 9:54:06 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D098	Detector L08D098	Manual	6/13/2025 9:54:26 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D097	Detector L08D097	Manual	6/13/2025 9:54:37 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L08M053	Module L08M053	Manual	6/13/2025 9:54:39 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D096	Detector L08D096	Manual	6/13/2025 9:54:47 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Smoke Detector - General	N001 L08D095	Detector L08D095	Manual	6/13/2025 9:54:57 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D094	Detector L08D094	Manual	6/13/2025 9:55:07 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D093	Detector L08D093	Manual	6/13/2025 9:55:18 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D092	Detector L08D092	Manual	6/13/2025 9:55:58 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Manual Fire Box	N001 L08M050	Module L08M050	Manual	6/13/2025 9:56:17 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D091	Detector L08D091	Manual	6/13/2025 9:56:34 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D089	Detector L08D089	Manual	6/13/2025 9:56:44 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D090	Detector L08D090	Manual	6/13/2025 9:56:54 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D085	Detector L08D085	Manual	6/13/2025 9:57:05 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D086	Detector L08D086	Manual	6/13/2025 9:57:14 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L08M035	Module L08M035	Manual	6/13/2025 9:57:23 AM

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D087	Detector L08D087	Manual	6/13/2025 9:57:25 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D076	Detector L08D076	Manual	6/13/2025 9:57:49 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L08M033	Module L08M033	Manual	6/13/2025 9:57:52 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D077	Detector L08D077	Manual	6/13/2025 9:57:57 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D078	Detector L08D078	Manual	6/13/2025 9:58:07 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L08M032	Module L08M032	Manual	6/13/2025 9:58:19 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D079	Detector L08D079	Manual	6/13/2025 9:58:22 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D080	Detector L08D080	Manual	6/13/2025 9:59:10 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D081	Detector L08D081	Manual	6/13/2025 9:59:24 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D082	Detector L08D082	Manual	6/13/2025 9:59:39 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D083	Detector L08D083	Manual	6/13/2025 9:59:50 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D084	Detector L08D084	Manual	6/13/2025 10:00:03 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Manual Fire Box	N001 L08M002	Module L08M002	Manual	6/13/2025 10:00:05 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D088	Detector L08D088	Manual	6/13/2025 10:00:16 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D072	Detector L08D072	Manual	6/13/2025 10:01:02 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D073	Detector L08D073	Manual	6/13/2025 10:01:14 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D074	Detector L08D074	Manual	6/13/2025 10:01:28 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D075	Detector L08D075	Manual	6/13/2025 10:01:39 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D068	Detector L08D068	Manual	6/13/2025 10:01:54 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D069	Detector L08D069	Manual	6/13/2025 10:02:29 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L04M007	Module L04M007	Manual	6/13/2025 10:04:10 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
[Other]	N001 L05M031	Module L05M031	Manual	6/13/2025 10:04:29 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L05M004	Module L05M004	Manual	6/13/2025 10:05:40 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D020	Detector L01D020	Manual	6/13/2025 10:06:02 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D021	Detector L01D021	Manual	6/13/2025 10:06:22 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D022	Detector L01D022	Manual	6/13/2025 10:06:41 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D023	Detector L01D023	Manual	6/13/2025 10:06:56 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D024	Detector L01D024	Manual	6/13/2025 10:07:32 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D025	Detector L01D025	Manual	6/13/2025 10:07:39 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D026	Detector L01D026	Manual	6/13/2025 10:08:26 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Manual Fire Box	N001 L06M010	Module L06M010	Manual	6/13/2025 10:08:37 AM
		Manufacturer	NOTIFIER	
		Model	NBG12LX	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D027	Detector L01D027	Manual	6/13/2025 10:08:44 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Functional Inspection	Failed	
[Other]	N001 L06M155	Module L06M155	Manual	6/13/2025 10:08:51 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D028	Detector L01D028	Manual	6/13/2025 10:09:05 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D029	Detector L01D029	Manual	6/13/2025 10:09:24 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D003	Detector L01D003	Manual	6/13/2025 10:09:43 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L07M020	Module L07M020	Manual	6/13/2025 10:09:43 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D030	Detector L01D030	Manual	6/13/2025 10:09:58 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L06M159	Module L06M159	Manual	6/13/2025 10:10:17 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D031	Detector L01D031	Manual	6/13/2025 10:10:18 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D032	Detector L01D032	Manual	6/13/2025 10:10:35 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L06M158	Module L06M158	Manual	6/13/2025 10:10:46 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D033	Detector L01D033	Manual	6/13/2025 10:10:53 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L06M157	Module L06M157	Manual	6/13/2025 10:11:07 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D034	Detector L01D034	Manual	6/13/2025 10:11:12 AM

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D035	Detector L01D035	Manual	6/13/2025 10:11:41 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L06M156	Module L06M156	Manual	6/13/2025 10:11:43 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D036	Detector L01D036	Manual	6/13/2025 10:11:57 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D037	Detector L01D037	Manual	6/13/2025 10:12:11 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D038	Detector L01D038	Manual	6/13/2025 10:12:29 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D039	Detector L01D039	Manual	6/13/2025 10:12:45 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Supervisory - Control Valve	N001 L05M080	Module L05M080	Manual	6/13/2025 10:14:25 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D004	Detector L01D004	Manual	6/13/2025 10:15:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D040	Detector L01D040	Manual	6/13/2025 10:15:34 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D010	Detector L06D010	Manual	6/13/2025 10:15:41 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D041	Detector L01D041	Manual	6/13/2025 10:15:52 AM

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D042	Detector L01D042	Manual	6/13/2025 10:16:10 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D025	Detector L06D025	Manual	6/13/2025 10:16:13 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D043	Detector L01D043	Manual	6/13/2025 10:16:41 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D044	Detector L01D044	Manual	6/13/2025 10:17:44 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D026	Detector L06D026	Manual	6/13/2025 10:17:45 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D045	Detector L01D045	Manual	6/13/2025 10:17:59 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D027	Detector L06D027	Manual	6/13/2025 10:18:06 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D047	Detector L01D047	Manual	6/13/2025 10:18:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D028	Detector L06D028	Manual	6/13/2025 10:18:17 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D029	Detector L06D029	Manual	6/13/2025 10:18:29 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D049	Detector L01D049	Manual	6/13/2025 10:18:33 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D003	Detector L06D003	Manual	6/13/2025 10:18:43 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D005	Detector L01D005	Manual	6/13/2025 10:18:50 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D030	Detector L06D030	Manual	6/13/2025 10:18:59 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D031	Detector L06D031	Manual	6/13/2025 10:19:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D050	Detector L01D050	Manual	6/13/2025 10:19:16 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D032	Detector L06D032	Manual	6/13/2025 10:19:29 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D006	Detector L01D006	Manual	6/13/2025 10:19:33 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D033	Detector L06D033	Manual	6/13/2025 10:19:51 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D060	Detector L01D060	Manual	6/13/2025 10:19:55 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D063	Detector L01D063	Manual	6/13/2025 10:20:25 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D068	Detector L01D068	Manual	6/13/2025 10:20:44 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D007	Detector L01D007	Manual	6/13/2025 10:21:00 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D076	Detector L01D076	Manual	6/13/2025 10:21:17 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D034	Detector L06D034	Manual	6/13/2025 10:21:28 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D077	Detector L01D077	Manual	6/13/2025 10:21:33 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D035	Detector L06D035	Manual	6/13/2025 10:21:42 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D036	Detector L06D036	Manual	6/13/2025 10:22:32 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D008	Detector L01D008	Manual	6/13/2025 10:22:41 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D037	Detector L06D037	Manual	6/13/2025 10:23:01 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D038	Detector L06D038	Manual	6/13/2025 10:23:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D041	Detector L06D041	Manual	6/13/2025 10:23:31 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D084	Detector L01D084	Manual	6/13/2025 10:23:37 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D043	Detector L06D043	Manual	6/13/2025 10:23:46 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D044	Detector L06D044	Manual	6/13/2025 10:23:59 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L01D009	Detector L01D009	Manual	6/13/2025 10:24:11 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D046	Detector L06D046	Manual	6/13/2025 10:24:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D046	Detector L07D046	Manual	6/13/2025 10:24:46 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D072	Detector L06D072	Manual	6/13/2025 10:24:55 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D071	Detector L06D071	Manual	6/13/2025 10:25:16 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Supervisory - Control Valve	N001 L06M020	Module L06M020	Manual	6/13/2025 10:25:18 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D070	Detector L06D070	Manual	6/13/2025 10:25:54 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D069	Detector L06D069	Manual	6/13/2025 10:26:07 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D068	Detector L06D068	Manual	6/13/2025 10:26:30 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D067	Detector L06D067	Manual	6/13/2025 10:26:46 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L04D047	Detector L04D047	Manual	6/13/2025 10:26:58 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D066	Detector L06D066	Manual	6/13/2025 10:27:03 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L04D046	Detector L04D046	Manual	6/13/2025 10:27:16 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D064	Detector L06D064	Manual	6/13/2025 10:27:25 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L04D045	Detector L04D045	Manual	6/13/2025 10:27:33 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Smoke Detector - General	N001 L04D031	Detector L04D031	Manual	6/13/2025 10:27:51 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L06D063	Detector L06D063	Manual	6/13/2025 10:28:24 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L06D061	Detector L06D061	Manual	6/13/2025 10:28:37 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L06D060	Detector L06D060	Manual	6/13/2025 10:28:48 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L06D062	Detector L06D062	Manual	6/13/2025 10:29:09 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L06D059	Detector L06D059	Manual	6/13/2025 10:29:30 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L03D032	Detector L03D032	Manual	6/13/2025 10:29:36 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L06D058	Detector L06D058	Manual	6/13/2025 10:29:55 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L03D030	Detector L03D030	Manual	6/13/2025 10:29:58 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L06D057	Detector L06D057	Manual	6/13/2025 10:30:09 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L03D029	Detector L03D029	Manual	6/13/2025 10:30:18 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D028	Detector L03D028	Manual	6/13/2025 10:30:36 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D056	Detector L06D056	Manual	6/13/2025 10:31:04 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D055	Detector L06D055	Manual	6/13/2025 10:31:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D054	Detector L06D054	Manual	6/13/2025 10:31:28 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D053	Detector L06D053	Manual	6/13/2025 10:31:37 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D025	Detector L03D025	Manual	6/13/2025 10:31:46 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D052	Detector L06D052	Manual	6/13/2025 10:31:51 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D022	Detector L03D022	Manual	6/13/2025 10:32:04 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D051	Detector L06D051	Manual	6/13/2025 10:32:14 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D050	Detector L06D050	Manual	6/13/2025 10:32:25 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D027	Detector L03D027	Manual	6/13/2025 10:32:30 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D048	Detector L06D048	Manual	6/13/2025 10:32:37 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D023	Detector L03D023	Manual	6/13/2025 10:32:47 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L06D047	Detector L06D047	Manual	6/13/2025 10:32:54 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D026	Detector L03D026	Manual	6/13/2025 10:33:36 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D021	Detector L03D021	Manual	6/13/2025 10:33:53 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D024	Detector L03D024	Manual	6/13/2025 10:34:11 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D019	Detector L03D019	Manual	6/13/2025 10:34:43 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D023	Detector L05D023	Manual	6/13/2025 10:34:50 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D016	Detector L03D016	Manual	6/13/2025 10:35:01 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D024	Detector L05D024	Manual	6/13/2025 10:35:02 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D026	Detector L05D026	Manual	6/13/2025 10:35:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D028	Detector L05D028	Manual	6/13/2025 10:35:29 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D020	Detector L03D020	Manual	6/13/2025 10:35:30 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D031	Detector L05D031	Manual	6/13/2025 10:35:43 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D017	Detector L03D017	Manual	6/13/2025 10:35:48 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D032	Detector L05D032	Manual	6/13/2025 10:35:55 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D033	Detector L05D033	Manual	6/13/2025 10:36:08 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D018	Detector L03D018	Manual	6/13/2025 10:36:09 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D015	Detector L03D015	Manual	6/13/2025 10:36:28 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Heat Detector - Restorable Spot	N001 L05D090	Detector L05D090	Manual	6/13/2025 10:36:56 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
		Alarm Sensitivity	Fixed	
Smoke Detector - General	N001 L03D014	Detector L03D014	Manual	6/13/2025 10:37:16 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D066	Detector L05D066	Manual	6/13/2025 10:37:16 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L03D013	Detector L03D013	Manual	6/13/2025 10:37:35 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D065	Detector L05D065	Manual	6/13/2025 10:37:38 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D048	Detector L05D048	Manual	6/13/2025 10:37:49 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D047	Detector L05D047	Manual	6/13/2025 10:38:09 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D032	Detector L02D032	Manual	6/13/2025 10:38:24 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D046	Detector L05D046	Manual	6/13/2025 10:38:30 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Heat Detector - Restorable Spot	N001 L05D045	Detector L05D045	Manual	6/13/2025 10:38:42 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	FST-851	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
		Alarm Sensitivity	Fixed	
Smoke Detector - General	N001 L02D031	Detector L02D031	Manual	6/13/2025 10:38:43 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D044	Detector L05D044	Manual	6/13/2025 10:39:04 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D030	Detector L02D030	Manual	6/13/2025 10:39:04 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D042	Detector L05D042	Manual	6/13/2025 10:39:19 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D029	Detector L02D029	Manual	6/13/2025 10:39:21 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D040	Detector L05D040	Manual	6/13/2025 10:39:31 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D028	Detector L02D028	Manual	6/13/2025 10:39:39 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D039	Detector L05D039	Manual	6/13/2025 10:39:43 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D027	Detector L02D027	Manual	6/13/2025 10:39:55 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D038	Detector L05D038	Manual	6/13/2025 10:40:06 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D026	Detector L02D026	Manual	6/13/2025 10:40:18 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D043	Detector L05D043	Manual	6/13/2025 10:40:20 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D036	Detector L05D036	Manual	6/13/2025 10:40:34 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D024	Detector L02D024	Manual	6/13/2025 10:40:38 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D025	Detector L02D025	Manual	6/13/2025 10:40:55 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D035	Detector L05D035	Manual	6/13/2025 10:40:59 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D023	Detector L02D023	Manual	6/13/2025 10:41:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D022	Detector L02D022	Manual	6/13/2025 10:41:33 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D021	Detector L02D021	Manual	6/13/2025 10:41:49 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D020	Detector L02D020	Manual	6/13/2025 10:42:06 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L05D034	Detector L05D034	Manual	6/13/2025 10:42:16 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D019	Detector L02D019	Manual	6/13/2025 10:42:42 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D018	Detector L02D018	Manual	6/13/2025 10:42:58 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D017	Detector L02D017	Manual	6/13/2025 10:43:22 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D016	Detector L02D016	Manual	6/13/2025 10:44:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D015	Detector L02D015	Manual	6/13/2025 10:44:32 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D014	Detector L02D014	Manual	6/13/2025 10:44:49 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D013	Detector L02D013	Manual	6/13/2025 10:45:12 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D016	Detector L07D016	Manual	6/13/2025 10:45:25 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D012	Detector L02D012	Manual	6/13/2025 10:45:29 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D011	Detector L02D011	Manual	6/13/2025 10:45:54 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D024	Detector L07D024	Manual	6/13/2025 10:46:03 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L02D010	Detector L02D010	Manual	6/13/2025 10:46:12 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D025	Detector L07D025	Manual	6/13/2025 10:46:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D027	Detector L07D027	Manual	6/13/2025 10:46:29 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D026	Detector L07D026	Manual	6/13/2025 10:46:44 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L02M008	Module L02M008	Manual	6/13/2025 10:46:46 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L03M005	Module L03M005	Manual	6/13/2025 10:47:04 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D028	Detector L07D028	Manual	6/13/2025 10:47:05 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D030	Detector L07D030	Manual	6/13/2025 10:47:17 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Supervisory - Control Valve	N001 L02M009	Module L02M009	Manual	6/13/2025 10:47:22 AM

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D031	Detector L07D031	Manual	6/13/2025 10:47:30 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Mechanical, Electrosonic, or Pressure Waterflow Device	N001 L04M021	Module L04M021	Manual	6/13/2025 10:47:36 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D032	Detector L07D032	Manual	6/13/2025 10:47:43 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Supervisory - Control Valve	N001 L04M022	Module L04M022	Manual	6/13/2025 10:47:53 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D033	Detector L07D033	Manual	6/13/2025 10:48:01 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Supervisory	N001 L05M030	Module L05M030	Manual	6/13/2025 10:48:07 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D034	Detector L07D034	Manual	6/13/2025 10:48:19 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D035	Detector L07D035	Manual	6/13/2025 10:48:32 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Supervisory - Control Valve	N001 L08M031	Module L08M031	Manual	6/13/2025 10:48:47 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D036	Detector L07D036	Manual	6/13/2025 10:48:57 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
[Other]	N001 L08M030	Module L08M030	Manual	6/13/2025 10:49:06 AM
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D037	Detector L07D037	Manual	6/13/2025 10:49:20 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Smoke Detector - General	N001 L07D038	Detector L07D038	Manual	6/13/2025 10:49:32 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L07D039	Detector L07D039	Manual	6/13/2025 10:49:48 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L07D040	Detector L07D040	Manual	6/13/2025 10:50:02 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L07D042	Detector L07D042	Manual	6/13/2025 10:50:20 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L07D041	Detector L07D041	Manual	6/13/2025 10:50:32 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L07D043	Detector L07D043	Manual	6/13/2025 10:50:47 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L07D044	Detector L07D044	Manual	6/13/2025 10:50:58 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L07D051	Detector L07D051	Manual	6/13/2025 10:51:33 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L07D050	Detector L07D050	Manual	6/13/2025 10:51:47 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L07D049	Detector L07D049	Manual	6/13/2025 10:51:59 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
Smoke Detector - General	N001 L07D047	Detector L07D047	Manual	6/13/2025 10:52:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D048	Detector L07D048	Manual	6/13/2025 10:52:30 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L07D045	Detector L07D045	Manual	6/13/2025 10:52:50 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D071	Detector L08D071	Manual	6/13/2025 10:56:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D067	Detector L08D067	Manual	6/13/2025 10:56:50 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D066	Detector L08D066	Manual	6/13/2025 10:57:11 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D065	Detector L08D065	Manual	6/13/2025 10:57:43 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D064	Detector L08D064	Manual	6/13/2025 10:57:56 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D070	Detector L08D070	Manual	6/13/2025 10:58:16 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D062	Detector L08D062	Manual	6/13/2025 10:58:35 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D061	Detector L08D061	Manual	6/13/2025 10:58:48 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D060	Detector L08D060	Manual	6/13/2025 10:59:01 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D059	Detector L08D059	Manual	6/13/2025 10:59:15 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D058	Detector L08D058	Manual	6/13/2025 10:59:29 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D057	Detector L08D057	Manual	6/13/2025 10:59:48 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D056	Detector L08D056	Manual	6/13/2025 11:00:01 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D055	Detector L08D055	Manual	6/13/2025 11:00:20 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D054	Detector L08D054	Manual	6/13/2025 11:00:34 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D053	Detector L08D053	Manual	6/13/2025 11:00:44 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D052	Detector L08D052	Manual	6/13/2025 11:00:56 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D063	Detector L08D063	Manual	6/13/2025 11:01:08 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D051	Detector L08D051	Manual	6/13/2025 11:01:53 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D049	Detector L08D049	Manual	6/13/2025 11:02:06 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D048	Detector L08D048	Manual	6/13/2025 11:02:23 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D047	Detector L08D047	Manual	6/13/2025 11:02:48 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D050	Detector L08D050	Manual	6/13/2025 11:03:16 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D045	Detector L08D045	Manual	6/13/2025 11:03:30 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D044	Detector L08D044	Manual	6/13/2025 11:03:48 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D043	Detector L08D043	Manual	6/13/2025 11:04:02 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D042	Detector L08D042	Manual	6/13/2025 11:04:16 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D041	Detector L08D041	Manual	6/13/2025 11:04:34 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D040	Detector L08D040	Manual	6/13/2025 11:04:52 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D030	Detector L08D030	Manual	6/13/2025 11:05:12 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D031	Detector L08D031	Manual	6/13/2025 11:05:25 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D033	Detector L08D033	Manual	6/13/2025 11:06:19 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D034	Detector L08D034	Manual	6/13/2025 11:06:32 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D032	Detector L08D032	Manual	6/13/2025 11:07:08 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D035	Detector L08D035	Manual	6/13/2025 11:07:23 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D036	Detector L08D036	Manual	6/13/2025 11:07:40 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D038	Detector L08D038	Manual	6/13/2025 11:07:57 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D039	Detector L08D039	Manual	6/13/2025 11:08:11 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D046	Detector L08D046	Manual	6/13/2025 11:10:26 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D029	Detector L08D029	Manual	6/13/2025 11:11:02 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D028	Detector L08D028	Manual	6/13/2025 11:11:13 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D027	Detector L08D027	Manual	6/13/2025 11:11:32 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D025	Detector L08D025	Manual	6/13/2025 11:11:58 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Heat Detector - Restorable Spot	N001 L08D024	Detector L08D024	Manual	6/13/2025 11:12:44 AM
		Manufacturer	NOTIFIER	
		Model	FST-851	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
		Alarm Sensitivity	Fixed	
Smoke Detector - General	N001 L08D102	Detector L08D102	Manual	6/13/2025 11:12:57 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D101	Detector L08D101	Manual	6/13/2025 11:13:10 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D103	Detector L08D103	Manual	6/13/2025 11:13:24 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D100	Detector L08D100	Manual	6/13/2025 11:13:36 AM
		Manufacturer	NOTIFIER	

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	
Smoke Detector - General	N001 L08D037	Detector L08D037	Manual	6/13/2025 11:13:55 AM
		Manufacturer	NOTIFIER	
		Model	SDX-551, FSP-851, FSP-951IV	
		Visual Inspection	Failed (Manual)	
		Functional Inspection	Failed	

**Power Supplies**

Passed

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Battery - Sealed Lead-acid	Main FACP Battery #1		Manual	6/9/2025 9:50:52 AM



Manufacturer	Duracell
Model	DURA12-55P
Visual Inspection	Passed (Manual)
Functional Inspection	Passed
Amp Hours	55
Nominal Voltage	12

Battery - Sealed Lead-acid	Main FACP Battery #2		Manual	6/9/2025 10:35:39 AM
----------------------------	----------------------	--	--------	----------------------



Manufacturer	Duracell
Model	DURA12-55P
Visual Inspection	Passed (Manual)
Functional Inspection	Passed
Amp Hours	55
Nominal Voltage	12

FCPS	POWER SUPPLY	IT ROOM ON FC CORRIDOR	Manual	6/13/2025 9:56:57 AM
------	--------------	------------------------	--------	----------------------

Manufacturer	Notifier
Model	FCPS-24S8
Visual Inspection	Passed (Manual)
Functional Inspection	Passed

FCPS	POWER SUPPLY	IT ROOM ON FC CORRIDOR	Manual	6/13/2025 9:57:09 AM
------	--------------	------------------------	--------	----------------------

Manufacturer	Notifier
Model	FCPS-24S8

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Battery - Sealed Lead-acid	POWER SUPPLY BATTERY #1	IT ROOM ON FC CORRIDOR	Manual	6/13/2025 10:00:14 AM
		Model	12v7.0ah	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Amp Hours	7	
		Nominal Voltage	12	
Battery - Sealed Lead-acid	POWER SUPPLY BATTERY #2	IT ROOM ON FC CORRIDOR	Manual	6/13/2025 10:00:31 AM
		Model	12v7.0ah	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Amp Hours	7	
		Nominal Voltage	12	
Battery - Sealed Lead-acid	POWER SUPPLY BATTERY #1	IT ROOM ON FC CORRIDOR	Manual	6/13/2025 10:00:44 AM
		Model	12v7.0ah	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Amp Hours	7	
		Nominal Voltage	12	
Battery - Sealed Lead-acid	POWER SUPPLY BATTERY#2	IT ROOM ON FC CORRIDOR	Manual	6/13/2025 10:01:05 AM
		Model	12v7.0ah	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Amp Hours	7	
		Nominal Voltage	12	
FCPS	ELECTRICAL RM POWER SUPPLY BY G POD (1)	POWER SUPPLY	Manual	6/13/2025 10:04:19 AM
		Manufacturer	Notifier	
		Model	FCPS-24S8	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
Battery - Sealed Lead-acid	ELECTRICAL RM POWER SUPPLY BY G POD	BATTERY#1	Manual	6/13/2025 10:05:11 AM
		Model	12v7.0ah	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Amp Hours	7	
		Nominal Voltage	12	
Battery - Sealed Lead-acid	ELECTRICAL RM POWER SUPPLY BY G POD	BATTERY#2	Manual	6/13/2025 10:05:31 AM
		Model	12v7.0ah	
		Visual Inspection	Passed (Manual)	
		Functional Inspection	Passed	
		Amp Hours	7	
		Nominal Voltage	12	

Failed

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
----------------	---------	-------------	--------	-----------

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Battery - Sealed Lead-acid		Sub FACP panel in I pod battery 1	Manual	6/11/2025 2:04:29 PM



Model	12v55ah
Visual Inspection	Failed (Manual)
Alarm Minutes	15
Amp Hours	55
Battery Location	Below panel
Stand By Hours	24

Battery - Sealed Lead-acid		Sub FACP panel in I pod battery 2	Manual	6/11/2025 2:05:26 PM
----------------------------	--	-----------------------------------	--------	----------------------

Model	12v55ah
Visual Inspection	Failed (Manual)
Alarm Minutes	15
Amp Hours	55
Battery Location	Below panel
Stand By Hours	24

### Supervising Station Transmitting Equipment

Failed

EQUIPMENT TYPE	ADDRESS	DESCRIPTION	METHOD	DATE/TIME
Digital Alarm Communicator Transmitter		DIALER next to FACP	Manual	6/13/2025 11:16:21 AM

Manufacturer	Notifier
Model	911A
Functional Inspection	Failed
Alarm Restore	-
Alarm Signal	-
Monitoring Account Number	N/a
Monitoring Organization	N/A
Monitoring Organization Address	N/A
Monitoring Organization eMail	N/A
Monitoring Organization Phone	N/A
Monitoring Phone Line 1	N/A
Monitoring Phone Line 2	N/A
Monitoring Retransmission Entity	Fire department
Supervisory Restore	-
Supervisory Signal	-
Trouble Restore	-
Trouble Signal	-

## Device/Equipment Details

### Emergency Communication Equipment

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
Bi-Directional Amplifier					
	Bio directional amplifier inside of FACP room	Advanced rf technology			06/11/2025

### Emergency Control Equipment

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
[Other]					
N005 L01M011	TRIP FROM WATERFLOW				04/08/2025
N001 L02M001	Pod B fan control				04/08/2025
N001 L02M002	Module L02M002				04/08/2025
N001 L04M014	Module L04M014				04/08/2025
N001 L05M002	Elevator alternate recall				04/08/2025
N001 L05M003	Primary elevator recall				04/08/2025
N001 L05M016	Pod E fan control				04/08/2025
N001 L05M017	POD E DOOR RELEASE				04/08/2025
N001 L05M032	Module L05M032				04/08/2025
N001 L05M060	Module L05M060				04/08/2025
N001 L05M061	Module L05M061				04/08/2025
N001 L05M062	Module L05M062				04/08/2025
N001 L05M070	Module L05M070				04/08/2025
N001 L05M073	Module L05M073				04/08/2025
N001 L07M013	AHU F shut down				04/08/2025
N001 L07M014	AHU F FAN CONTROL				04/08/2025
N001 L07M015	AHU f fan control				04/08/2025
N001 L07M016	AHU F fan control				04/08/2025
N001 L07M017	AHU F fan control				04/08/2025
N001 L07M018	AHU F fan control				04/08/2025
N001 L07M019	Antifreeze system				04/08/2025
N001 L01M001	Pod A Fan Control				04/08/2025
N001 L01M002	Pod A Door Release				04/08/2025
L01M002					
N001 L01M091	Module L01M091				04/08/2025
N001 L01M092	Module L01M092				04/08/2025
N001 L01M093	Pod D shut down				04/08/2025
N001 L01M094	Pod D fan control				04/08/2025
N001 L01M095	Module L01M095				04/08/2025
N001 L01M096	Module L01M096				04/08/2025
N001 L01M097	Module L01M097				04/08/2025
N001 L01M098	Module L01M098				04/08/2025
N001 L01M099	DOOR RELEASE				04/08/2025
N001 L03M002	Pod C fan control				04/08/2025
N001 L03M003	POD C DOOR RELEASE				04/08/2025
N001 L04M001	Module L04M001				04/08/2025
N001 L04M002	Module L04M002				04/08/2025
N001 L06M012	G Block fan control				04/08/2025
N001 L06M013	G Block fan control				04/08/2025
N001 L06M014	G Block fan control				04/08/2025
N001 L06M015	G Block fan control				04/08/2025
N001 L06M016	G Block fan control				04/08/2025
N001 L06M017	G Block fan control				04/08/2025
N001 L06M018	G Block fan control				04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L06M019	G block HVAC shut down				04/08/2025
N001 L08M017	AHU H shutdown				04/08/2025
N001 L08M018	AHU H shutdown				04/08/2025
N001 L08M019	AHU H fan control				04/08/2025
N001 L08M020	AHU H fan control				04/08/2025
N001 L08M021	AHU H fan control				04/08/2025
N001 L08M022	Door control relay				04/08/2025
N001 L08M023	Door holders, FC corridor				04/08/2025

### Fire Control Panel

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
Fire Alarm Panel					
N005 N005	Sub FACP panel in I pod	NOTIFIER	NFS 320		04/08/2025
N001 N001	main FACP in main telco room	NOTIFIER	NFS 3030		04/08/2025

### Remote Annunciator

	Booking control room, A Pod	NOTIFIER	LCD-80		06/11/2025
	Booking control I Pod	NOTIFIER	LCD-80		06/11/2025
	Booking control room, B Pod	NOTIFIER	LCD-80		06/11/2025
	Booking control room, C Pod	NOTIFIER	LCD-80		06/11/2025
	Booking control room, E Pod	NOTIFIER	LCD-80		06/11/2025
	Booking control room, G Pod	NOTIFIER	LCD-80		06/11/2025
	Booking control room, H Pod	NOTIFIER	LCD-80		06/11/2025
	Booking control room, F Pod	NOTIFIER	LCD-80		06/11/2025

### Initiating Device

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
Smoke Detector - General					
N005 L01D001	INMATE VESTIBULE	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D010	CORRIDOR 1030	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D011	FINGERPRINT AND I.D.	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D012	INMATE CORRIDOR 1085	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D013	CORRIDOR 1024	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D014	CORRIDOR 1024	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D015	CORRIDOR 1024	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D016	INMATE CORRIDOR 1008	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D017	INMATE CORRIDOR 1008	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D018	MECHANICAL HALLWAY	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D019	MECHANICAL HALLWAY	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D002	CORRIDOR 1060	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D020	MECHANICAL HALLWAY	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D021	MECHANICAL HALLWAY	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D022	FINGERPRINT AND I.D.	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D023	INMATE CORRIDOR 1085	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D025	INMATE CORRIDOR 1085	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D029	MECHANICAL 1201	NOTIFIER	Fsp-851		04/08/2025
N005 L01D003	CORRIDOR 1060	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D030	TELE/DATA RM 1007	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D031	COMMUNICATIONS ROOM	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D004	CORRIDOR 1060	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D005	CORRIDOR 1052	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D006	FORMS	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D007	OFFICER WRITE UP	NOTIFIER	Fsp-851t		04/08/2025
N005 L01D008	METAL DETECTOR	NOTIFIER	Fsp-851t		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N005 L01D009	PRE-BOOKING	NOTIFIER	Fsp-951t		04/08/2025
N001 L01D001	Detector L01D001	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D002	Detector L01D002	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D003	Detector L01D003	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D004	Detector L01D004	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D005	Detector L01D005	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D006	Detector L01D006	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D007	Detector L01D007	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D008	Detector L01D008	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D009	Detector L01D009	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D010	Detector L01D010	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D011	Detector L01D011	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D012	Detector L01D012	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D013	2nd floor corridor at smoke doors	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D014	Detector L01D014	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D015	Detector L01D015	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D016	Detector L01D016	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D017	Detector L01D017	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D018	Detector L01D018	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D019	Detector L01D019	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D020	Detector L01D020	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D021	Detector L01D021	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D022	Detector L01D022	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D023	Detector L01D023	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D024	Detector L01D024	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D025	Detector L01D025	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D026	Detector L01D026	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D027	Detector L01D027	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D028	Detector L01D028	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D029	Detector L01D029	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D030	Detector L01D030	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D031	Detector L01D031	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D032	Detector L01D032	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D033	Detector L01D033	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D034	Detector L01D034	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D035	Detector L01D035	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D036	Detector L01D036	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D037	Detector L01D037	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L01D038	Detector L01D038	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D039	Detector L01D039	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D040	Detector L01D040	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D041	Detector L01D041	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D042	Detector L01D042	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D043	Detector L01D043	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D044	Detector L01D044	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D045	Detector L01D045	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D046	Detector L01D046	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D047	Detector L01D047	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D048	Detector L01D048	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D049	Detector L01D049	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D050	Detector L01D050	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D051	Mechanical room a 245	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D052	Mechanical room a 245	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D053	Mechanical room a 245	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D054	Mechanical room a 245	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D055	CENTRAL HALL CORRIDOR POD A	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D059	2ND FL FILES RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D060	Detector L01D060	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D063	Detector L01D063	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D064	Outside visitation a	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D065	2nd floor corridor	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D066	2nd floor corridor	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D067	2nd floor corridor	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D068	Detector L01D068	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D069	2nd floor corridor	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D070	2nd fl elevator lobby	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D071	2nd floor corridor outside visitation B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D072	2nd floor corridor	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D073	2nd fl corridor	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D074	2nd fl corridor	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D075	2nd fl corridor	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D076	Detector L01D076	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D077	Detector L01D077	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D078	2nd floor elevator lobby	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D079	2nd fl corridor	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L01D080	2nd fl sprinkler closet	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D081	2nd fl corridor	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D082	2nd floor corridor storage room d block	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D083	2nd fl corridor at smoke doors	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D084	Detector L01D084	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D085	2nd fl corridor at smoke doors	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D086	2nd floor corridor at smoke doors	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D089	2nd floor IT room	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D090	2nd fl corridor Area E	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D091	POD D COMMON AREA	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D095	RECEPTION JANITORS CLOSET	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D097	1st fl elevator lobby	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D098	Lobby Corridor Smoke	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L01D099	Lobby Corridor	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D065	D HALL STORAGE RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D087	CORRIDOR OUTSIDE B POD	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D088	CORRIDOR D HALL AT SMOKE DOOR	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D092	Corridor Outside Kitchen	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D093	Corridor Outside Kitchen	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D094	Corridor Outside Dining Hall	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D001	CONTROL TOWER POD C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D002	CONTROL TOWER POD C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D003	CONTROL TOWER POD C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D004	STORAGE RM C POD	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D005	STORAGE RM C POD	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D006	JANITORS CLOSET POD C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D007	SUPERVISORS OFFICE POD C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D008	COMMON AREA POD C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D009	STORAGE POD C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D010	MEDICAL STORAGE C POD	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D011	laundry smoke	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D012	Laundry	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D015	JANITOR LAUNDRY	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D016	Detector L04D016	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D017	Laundry storage	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D020	Staff dining	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D021	WAREHOUSE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L04D022	WAREHOUSE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D023	WAREHOUSE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D024	WAREHOUSE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D025	Warehouse	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D026	WAREHOUSE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D031	Detector L04D031	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D032	T2 DAY RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D033	T1 Day Rm	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D034	Detector L04D034	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D037	Detector L04D037	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D038	E POD MECHANICAL RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D043	COMMON AREA POD D	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D044	COMMON AREA POD D	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D045	Detector L04D045	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D046	Detector L04D046	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D047	Detector L04D047	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D049	COMMON AREA POD D	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D050	COMMON AREA POD D	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D002	BOOKING I POD	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D003	mechanical rm E088	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D005	BOOKING I POD	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D006	mechanical rm E088	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D009	File storage rm E113	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D010	Admin Area Over Resceptionist Desk	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D012	Mechanical rm E085	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D013	Mechanical rm E085	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D021	Mechanical rm 058	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D022	mechanical rm E088	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D023	Detector L05D023	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D024	Detector L05D024	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D026	Detector L05D026	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D028	Detector L05D028	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D029	E POD TOWER BASEMENT	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D030	E POD TOWER BASEMENT	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D031	Detector L05D031	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D032	Detector L05D032	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D033	Detector L05D033	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L05D034	Detector L05D034	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D035	Detector L05D035	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D036	Detector L05D036	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D038	Detector L05D038	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D039	Detector L05D039	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D040	Detector L05D040	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D042	Detector L05D042	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D043	Detector L05D043	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D044	Detector L05D044	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D056	E POD BLOCK D DAY RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D057	E POD BLOCK D DAY RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D058	E POD E BLOCK	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D059	E POD E BLOCK	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D060	E POD MAIN CORRIDOR	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D061	E POD MAIN CORRIDOR	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D062	E POD CORRIDOR	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D063	E POD CORRIDOR	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D064	E POD MAIN CORRIDOR	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D065	Detector L05D065	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D066	Detector L05D066	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D068	Mechanical rm 058	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D070	Detector L05D070	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D072	Detector L05D072	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D001	GD PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D002	GD PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D003	Detector L06D003	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D004	GD PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D005	GD PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D006	GE PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D007	GF PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D008	GF PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D009	Detector L06D009	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D010	Detector L06D010	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D011	GF PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D012	GF PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D013	GA PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D014	GA PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L06D015	GA PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D016	GA PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D017	GB PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D018	GB PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D019	GB PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D020	GA PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D021	GC PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D022	GC PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D023	GB PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D024	GC PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D025	Detector L06D025	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D026	Detector L06D026	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D027	Detector L06D027	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D028	Detector L06D028	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D029	Detector L06D029	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D030	Detector L06D030	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D031	Detector L06D031	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D032	Detector L06D032	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D033	Detector L06D033	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D034	Detector L06D034	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D035	Detector L06D035	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D036	Detector L06D036	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D037	Detector L06D037	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D038	Detector L06D038	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D039	Detector L06D039	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D040	Detector L06D040	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D041	Detector L06D041	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D042	Detector L06D042	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D043	Detector L06D043	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D044	Detector L06D044	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D045	Detector L06D045	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D046	Detector L06D046	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D047	Detector L06D047	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D048	Detector L06D048	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D049	Detector L06D049	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D050	Detector L06D050	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D051	Detector L06D051	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L06D052	Detector L06D052	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D053	Detector L06D053	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D054	Detector L06D054	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D055	Detector L06D055	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D056	Detector L06D056	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D057	Detector L06D057	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D058	Detector L06D058	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D059	Detector L06D059	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D060	Detector L06D060	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D061	Detector L06D061	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D062	Detector L06D062	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D063	Detector L06D063	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D064	Detector L06D064	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D031	Detector L07D031	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D032	Detector L07D032	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D033	Detector L07D033	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D034	Detector L07D034	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D035	Detector L07D035	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D036	Detector L07D036	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D037	Detector L07D037	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D038	Detector L07D038	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D039	Detector L07D039	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D040	Detector L07D040	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D041	Detector L07D041	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D054	POD F DATA RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D001	IT room by FC corridor	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D057	Detector L08D057	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D058	Detector L08D058	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D059	Detector L08D059	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D060	Detector L08D060	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D061	Detector L08D061	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D062	Detector L08D062	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D063	Detector L08D063	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D064	Detector L08D064	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D065	Detector L08D065	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D066	Detector L08D066	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D067	Detector L08D067	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L08D068	Detector L08D068	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D069	Detector L08D069	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D070	Detector L08D070	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D071	Detector L08D071	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D072	Detector L08D072	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D073	Detector L08D073	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D074	Detector L08D074	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D075	Detector L08D075	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D076	Detector L08D076	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D077	Detector L08D077	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D078	Detector L08D078	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D001	CONTROL TOWER POD B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D002	CONTROL TOWER POD B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D003	CONTROL TOWER POD B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D004	STORAGE ACROSS MEDICAL POD B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D005	STORAGE ACROSS MEDICAL POD B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D006	B POD SALLY PORT	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D007	COMMON AREA POD B SALLY PORT	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D008	COMMISSARY POD B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D009	STORAGE ACROSS MEDICAL POD B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D010	Detector L02D010	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D011	Detector L02D011	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D012	Detector L02D012	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D013	Detector L02D013	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D014	Detector L02D014	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D015	Detector L02D015	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D016	Detector L02D016	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D017	Detector L02D017	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D018	Detector L02D018	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D019	Detector L02D019	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D020	Detector L02D020	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D021	Detector L02D021	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D022	Detector L02D022	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D023	Detector L02D023	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D024	Detector L02D024	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D025	Detector L02D025	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D026	Detector L02D026	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L02D027	Detector L02D027	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D028	Detector L02D028	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D029	Detector L02D029	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D030	Detector L02D030	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D031	Detector L02D031	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D032	Detector L02D032	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D033	DAY ROOM B POD AREA F	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D034	DAY ROOM B POD AREA F	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D036	DAY ROOM B POD AREA E	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D037	DAY ROOM B POD AREA D	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D038	Detector L02D038	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D039	DAY ROOM B POD AREA C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D040	DAY ROOM B POD AREA C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D041	DAY ROOM B POD AREA B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D042	DAY ROOM B POD AREA B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D043	B POD AREA A	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D044	B POD AREA A	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D045	COMMON AREA POD B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D046	COMMON AREA POD B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D047	COMMON AREA POD B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D048	COMMON AREA POD B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D049	COMMON AREA POD B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D050	Mechanical room B246 2nd floor	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D051	Mechanical room B246	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D052	Mechanical room B246	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D053	Mechanical room B246	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D054	janitors closet, pod b	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D056	CORRIDOR D HALL	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D057	CORRIDOR D HALL AT SMOKE DOOR	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D058	CORRIDOR D HALL	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D059	CORRIDOR D HALL	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D060	CORRIDOR OUTSIDE C POD	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D061	1ST FL CORRIDOR OUTSIDE STORAGE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D062	CENTRAL HALL CORRIDOR	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L02D063	D HALL FOOD STORAGE RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D013	Detector L03D013	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D014	Detector L03D014	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L03D015	Detector L03D015	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D016	Detector L03D016	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D017	Detector L03D017	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D018	Detector L03D018	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D019	Detector L03D019	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D020	Detector L03D020	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D021	Detector L03D021	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D022	Detector L03D022	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D023	Detector L03D023	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D024	Detector L03D024	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D025	Detector L03D025	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D026	Detector L03D026	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D027	Detector L03D027	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D028	Detector L03D028	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D029	Detector L03D029	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D030	Detector L03D030	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D031	Detector L03D031	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D032	Detector L03D032	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D033	DAY ROOM C POD AREA A	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D034	DAY ROOM C POD AREA A	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D035	DAY ROOM C POD AREA B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D036	DAY ROOM C POD AREA B	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D037	DAY ROOM C POD AREA C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D038	DAY ROOM C POD AREA C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D039	DAY ROOM C POD AREA D	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D040	DAY ROOM C POD AREA D	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D041	DAY ROOM C POD AREA E	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D042	DAY ROOM C POD AREA E	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D043	Detector L03D043	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D044	DAY ROOM C POD AREA F	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D045	Mechanical rm C246	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D046	Mechanical rm C246	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D047	Mechanical rm C246	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D048	Mechanical rm C246	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D049	COMMON AREA POD C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D050	COMMON AREA POD C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L03D051	COMMON AREA POD C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L03D052	COMMON AREA POD C	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D001	hazardous Chem storage kitchen	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D002	kitchen storage smoke	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D003	kitchen storage	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D005	Loading Dock Storage	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D008	Kitchen	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D009	Maintenance office	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D010	Laundry storage	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D051	COMMON AREA POD D	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D052	Laundry	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D054	janitors closet P082 smoke	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D096	Detector L04D096	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D097	Armory	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D098	Sargents Office	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L04D099	E POD MECHANICAL RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D046	Detector L05D046	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D047	Detector L05D047	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D048	Detector L05D048	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D049	E POD A BLOCK DAY RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D050	E POD A BLOCK DAY RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D051	E POD B DAY RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D052	E POD B DAY RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D053	E POD MAIN CORRIDOR	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D054	E POD C BLOCK DAY RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L05D055	E POD C BLOCK DAY RM	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D065	Detector L06D065	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D066	Detector L06D066	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D067	Detector L06D067	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D068	Detector L06D068	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D069	Detector L06D069	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D070	Detector L06D070	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D071	Detector L06D071	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D072	Detector L06D072	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L06D074	MECHANICAL RM D HALL CORRIDOR	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D002	FF PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D003	FF PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D004	FF PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L07D005	FE PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D006	FE PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D007	FE PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D008	FD PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D009	FD PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D010	FD PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D011	FD PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D012	Detector L07D012	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D013	FC PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D014	FC PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D015	Detector L07D015	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D016	Detector L07D016	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D017	FB PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D018	FB PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D019	FA PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D020	FB PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D021	FA PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D022	Detector L07D022	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D023	Detector L07D023	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D024	Detector L07D024	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D025	Detector L07D025	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D026	Detector L07D026	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D027	Detector L07D027	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D028	Detector L07D028	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D029	Detector L07D029	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D030	Detector L07D030	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D042	Detector L07D042	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D043	Detector L07D043	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D044	Detector L07D044	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D045	Detector L07D045	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D046	Detector L07D046	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D047	Detector L07D047	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D048	Detector L07D048	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D049	Detector L07D049	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D050	Detector L07D050	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L07D051	Detector L07D051	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D002	MECHANICAL RM H POD PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L08D003	MECHANICAL RM H POD PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D004	MECHANICAL RM H POD PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D005	MECHANICAL RM H POD PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D006	M MED PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D007	M MED PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D008	M MED PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D009	M MED PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D010	F MED PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D011	F MED PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D012	F MED PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D013	F MED PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D014	FMH PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D015	Detector L08D015	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D016	FMH PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D017	FMH PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D018	MMH PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D019	MMH PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D020	MMH PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D021	MMH PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D022	MMH PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D023	MECHANICAL RM H POD PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D025	Detector L08D025	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D026	MECHANICAL RM H POD PIPE CHASE	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D027	Detector L08D027	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D028	Detector L08D028	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D029	Detector L08D029	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D030	Detector L08D030	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D031	Detector L08D031	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D032	Detector L08D032	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D033	Detector L08D033	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D034	Detector L08D034	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D035	Detector L08D035	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D036	Detector L08D036	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D037	Detector L08D037	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D038	Detector L08D038	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D039	Detector L08D039	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D040	Detector L08D040	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L08D041	Detector L08D041	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D042	Detector L08D042	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D043	Detector L08D043	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D044	Detector L08D044	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D045	Detector L08D045	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D046	Detector L08D046	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D047	Detector L08D047	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D048	Detector L08D048	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D049	Detector L08D049	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D050	Detector L08D050	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D051	Detector L08D051	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D052	Detector L08D052	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D053	Detector L08D053	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D054	Detector L08D054	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D055	Detector L08D055	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D056	Detector L08D056	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D079	Detector L08D079	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D080	Detector L08D080	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D081	Detector L08D081	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D082	Detector L08D082	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D083	Detector L08D083	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D084	Detector L08D084	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D085	Detector L08D085	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D086	Detector L08D086	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D087	Detector L08D087	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D088	Detector L08D088	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D089	Detector L08D089	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D090	Detector L08D090	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D091	Detector L08D091	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D092	Detector L08D092	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D093	Detector L08D093	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D094	Detector L08D094	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D095	Detector L08D095	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D096	Detector L08D096	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D097	Detector L08D097	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D098	Detector L08D098	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D099	Detector L08D099	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L08D100	Detector L08D100	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D101	Detector L08D101	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D102	Detector L08D102	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D103	Detector L08D103	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D130	HOSPITAL CORRIDOR	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
N001 L08D131	HOSPITAL CORRIDOR	NOTIFIER	SDX-551, FSP-851, FSP-951IV		04/08/2025
Smoke Detector - Duct					
N005 L01D027	MECHANICAL 1201	System sensor	DNR/851R		04/08/2025
N005 L01D028	MECHANICAL 1201	NOTIFIER	DNR/851R		04/08/2025
Manual Fire Box					
N005 L01M001	RELEASE CONTROL	NOTIFIER	NBG12LX		04/08/2025
N005 L01M002	SALLYPORT 1042	NOTIFIER	NBG12LX		04/08/2025
N005 L01M003	SALLYPORT 1037	NOTIFIER	NBG12LX		04/08/2025
N005 L01M004	SALLYPORT 1102	NOTIFIER	NBG12LX		04/08/2025
N005 L01M005	SALLYPORT 1103	NOTIFIER	NBG12LX		04/08/2025
N005 L01M009	SALLYPORT 1075	NOTIFIER	NBG12LX		04/08/2025
N001 L07M001	POD F DATA RM	NOTIFIER	NBG12LX		04/08/2025
N001 L07M002	FC PIPE CHASE EXIT BOILER RM	NOTIFIER	NBG12LX		04/08/2025
N001 L07M003	FD PIPE CHASE EXIT 2	NOTIFIER	NBG12LX		04/08/2025
N001 L07M004	FD PIPE CHASE EXIT	NOTIFIER	NBG12LX		04/08/2025
N001 L07M007	FC PIPE CHASE EXIT 2	NOTIFIER	NBG12LX		04/08/2025
N001 L07M008	FC PIPE CHASE EXIT #1	NOTIFIER	NBG12LX		04/08/2025
N001 L07M009	FA PIPE CHASE	NOTIFIER	NBG12LX		04/08/2025
N001 L07M010	SALLY PORT ACROSS FROM I POD	NOTIFIER	NBG12LX		04/08/2025
N001 L07M012	POD F Control Tower	NOTIFIER	NBG12LX		04/08/2025
N001 L04M003	Staff D hall	NOTIFIER	NBG12LX		04/08/2025
N001 L06M001	POD G SOUTH EXIT	NOTIFIER	NBG12LX		04/08/2025
N001 L06M002	GD PIPE CHASE EXIT	NOTIFIER	NBG12LX		04/08/2025
N001 L06M003	GE PIPE CHASE EXIT	NOTIFIER	NBG12LX		04/08/2025
N001 L06M004	GF PIPE CHASE EXIT	NOTIFIER	NBG12LX		04/08/2025
N001 L06M006	D HALL CORRIDOR EXIT	NOTIFIER	NBG12LX		04/08/2025
N001 L06M007	GA PIPE CHASE	NOTIFIER	NBG12LX		04/08/2025
N001 L06M008	GA PIPE CHASE	NOTIFIER	NBG12LX		04/08/2025
N001 L06M009	GC PIPE CHASE	NOTIFIER	NBG12LX		04/08/2025
N001 L06M010	Module L06M010	NOTIFIER	NBG12LX		04/08/2025
N001 L06M011	POD G CONTROL TOWER	NOTIFIER	NBG12LX		04/08/2025
N001 L08M002	Module L08M002	NOTIFIER	NBG12LX		04/08/2025
N001 L08M006	MECHANICAL RM H POD PIPE CHASE	NOTIFIER	NBG12LX		04/08/2025
N001 L08M008	MMH PIPE CHASE	NOTIFIER	NBG12LX		04/08/2025
N001 L08M009	MMH PIPE CHASE	NOTIFIER	NBG12LX		04/08/2025
N001 L08M010	MMH PIPE CHASE	NOTIFIER	NBG12LX		04/08/2025
N001 L08M011	FMH PIPE CHASE	NOTIFIER	NBG12LX		04/08/2025
N001 L08M013	F MED PIPE CHASE	NOTIFIER	NBG12LX		04/08/2025
N001 L08M014	M MED PIPE CHASE	NOTIFIER	NBG12LX		04/08/2025
N001 L08M016	H pod tower	NOTIFIER	NBG12LX		04/08/2025
N001 L08M050	Module L08M050	NOTIFIER	NBG12LX		04/08/2025
N001 L08M051	ROLL CALL RM	NOTIFIER	NBG12LX		04/08/2025
N001 L08M052	FC chiller room exit	NOTIFIER	NBG12LX		04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
[Other]					
N005 L01M012	TRIP FROM WATERFLOW				04/08/2025
N001 L02M006	POD B TOWER PULL STATION	NOTIFIER	NBG12LX		04/08/2025
N001 L02M008	Module L02M008				04/08/2025
N001 L02M009	Module L02M009				04/08/2025
N001 L02M030	Mechanical room B246				04/08/2025
N001 L04M020	Tamper in back warehouse, D-Block				04/08/2025
N001 L04M021	Module L04M021				04/08/2025
N001 L04M022	Module L04M022				04/08/2025
N001 L05M004	Module L05M004	NOTIFIER	NBG12LX		04/08/2025
N001 L05M005	ADMIN HEARING RM	NOTIFIER	NBG12LX		04/08/2025
N001 L05M009	Jail Admin Lobby	NOTIFIER	NBG12LX		04/08/2025
N001 L05M014	Mechanical room E058				04/08/2025
N001 L05M015	Mechanical room E058				04/08/2025
N001 L05M020	tamper above E pod control tower				04/08/2025
N001 L05M030	Module L05M030				04/08/2025
N001 L05M031	Module L05M031				04/08/2025
N001 L05M050	E POD CONTROL TOWER	NOTIFIER	NBG12LX		04/08/2025
N001 L05M080	Module L05M080				04/08/2025
N001 L07M005	Pod F North stair exit	NOTIFIER	NBG12LX		04/08/2025
N001 L07M006	Pod F North exit	NOTIFIER	NBG12LX		04/08/2025
N001 L07M011	Pod E exit to FC corridor	NOTIFIER	NBG12LX		04/08/2025
N001 L07M020	Module L07M020				04/08/2025
N001 L01M006	Module L01M006	NOTIFIER	NBG12LX		04/08/2025
N001 L01M007	Mechanical rm C246	NOTIFIER	NBG12LX		04/08/2025
N001 L01M008	Outside visitation a	NOTIFIER	NBG12LX		04/08/2025
N001 L01M009	Mechanical room a 245	NOTIFIER	NBG12LX		04/08/2025
N001 L01M012	MECHANICAL RM POD B	NOTIFIER	NBG12LX		04/08/2025
N001 L01M015	2nd fl elevator lobby	NOTIFIER	NBG12LX		04/08/2025
N001 L01M016	2nd floor paper storage				04/08/2025
N001 L01M017	Water flow in ceiling in visitation E				04/08/2025
N001 L01M018	Tamper in ceiling in visitation E				04/08/2025
N001 L01M019	Riser closet on second floor corridor				04/08/2025
N001 L01M020	Riser closet on second floor corridor				04/08/2025
N001 L01M021	Second floor corridor, sprinkler closet				04/08/2025
N001 L01M022	Second floor corridor, sprinkler closet over kitchen				04/08/2025
N001 L01M023	Module L01M023				04/08/2025
N001 L01M031	Central control	NOTIFIER	NBG12LX		04/08/2025
N001 L01M075	dpod corridor sliders	NOTIFIER	NBG12LX		04/08/2025
N001 L03M004	CONTROL TOWER POD C	NOTIFIER	NBG12LX		04/08/2025
N001 L03M005	Module L03M005				04/08/2025
N001 L03M030	Mechanical room, C				04/08/2025
N001 L04M007	Module L04M007	NOTIFIER	NBG12LX		04/08/2025
N001 L06M005	D HALL EXIT	NOTIFIER	NBG12LX		04/08/2025
N001 L06M020	Module L06M020				04/08/2025
N001 L06M155	Module L06M155				04/08/2025
N001 L06M156	Module L06M156				04/08/2025
N001 L06M157	Module L06M157				04/08/2025
N001 L06M158	Module L06M158				04/08/2025

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
N001 L06M159	Module L06M159				04/08/2025
N001 L08M001	CORRIDOR BY MEDICAL				04/08/2025
N001 L08M003	MEDICAL EMERGENCY EXIT SALLYPORT	NOTIFIER	NBG12LX		04/08/2025
N001 L08M004	MEDICAL RECEPTIONS DESK	NOTIFIER	NBG12LX		04/08/2025
N001 L08M005	outside mechanical slider	NOTIFIER	NBG12LX		04/08/2025
N001 L08M007	Module L08M007				04/08/2025
N001 L08M012	Pod H Sally Port	NOTIFIER	NBG12LX		04/08/2025
N001 L08M015	MEDICAL RECEPTIONS DESK	NOTIFIER	NBG12LX		04/08/2025
N001 L08M030	Module L08M030				04/08/2025
N001 L08M031	Module L08M031				04/08/2025
N001 L08M032	Module L08M032				04/08/2025
N001 L08M033	Module L08M033				04/08/2025
N001 L08M034	Antifreeze system				04/08/2025
N001 L08M035	Module L08M035				04/08/2025
N001 L08M036	fc chiller room riser I				04/08/2025
N001 L08M053	Module L08M053				04/08/2025
N001 L08M055	FC CHILLER ROOM RISER F				04/08/2025
N001 L08M056	Module L08M056				04/08/2025
N001 L08M057	Module L08M057				04/08/2025
Heat Detector - Restorable Spot					
N001 L04D013	Detector L04D013	NOTIFIER	FST-851		04/08/2025
N001 L04D014	Detector L04D014	NOTIFIER	FST-851		04/08/2025
N001 L04D018	Kitchen	NOTIFIER	FST-851		04/08/2025
N001 L04D019	Kitchen	NOTIFIER	FST-851		04/08/2025
N001 L04D027	CENTRAL PLANT	NOTIFIER	FST-851		04/08/2025
N001 L04D028	CENTRAL PLANT	NOTIFIER	FST-851		04/08/2025
N001 L04D029	CENTRAL PLANT	NOTIFIER	FST-851		04/08/2025
N001 L04D030	CENTRAL PLANT	NOTIFIER	FST-851		04/08/2025
N001 L05D041	E POD B WATER HEATER RM	NOTIFIER	FST-851		04/08/2025
N001 L05D090	Detector L05D090	NOTIFIER	FST-851		04/08/2025
N001 L04D004	Kitchen	NOTIFIER	FST-851		04/08/2025
N001 L04D006	Detector L04D006	NOTIFIER	FST-851		04/08/2025
N001 L04D007	Kitchen	NOTIFIER	FST-851		04/08/2025
N001 L05D045	Detector L05D045	NOTIFIER	FST-851		04/08/2025
N001 L06D073	MECHANICAL RM D HALL CORRIDOR	NOTIFIER	FST-851		04/08/2025
N001 L06D075	D HALL MECHANICAL RM	NOTIFIER	FST-851		04/08/2025
N001 L07D001	POD F DATA RM	NOTIFIER	FST-851		04/08/2025
N001 L07D052	POD F DATA RM	NOTIFIER	FST-851		04/08/2025
N001 L08D024	Detector L08D024	NOTIFIER	FST-851		04/08/2025
Supervisory - High/Low Air Pressure Switch					
N1.L2.M30(2)	Mechanical room B246				04/08/2025
<b>Power Supplies</b>					
ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
Battery - Sealed Lead-acid					
	Main FACP Battery #1	Duracell	DURA12-55P		10/18/2024
	Main FACP Battery #2	Duracell	DURA12-55P		10/18/2024
	Sub FACP panel in I pod battery 1		12v55ah		04/08/2016
	Sub FACP panel in I pod battery 2		12v55ah		04/08/2016
POWER SUPPLY BATTERY #1	IT ROOM ON FC CORRIDOR		12v7.0ah		06/13/2024

ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
POWER SUPPLY BATTERY #2	IT ROOM ON FC CORRIDOR		12v7.0ah		06/13/2024
POWER SUPPLY BATTERY #1	IT ROOM ON FC CORRIDOR		12v7.0ah		06/13/2024
POWER SUPPLY BATTERY#2	IT ROOM ON FC CORRIDOR		12v7.0ah		06/13/2024
ELECTRICAL RM POWER SUPPLY BY G POD	BATTERY#1		12v7.0ah		06/13/2024
ELECTRICAL RM POWER SUPPLY BY G POD	BATTERY#2		12v7.0ah		06/13/2024

FCPS					
POWER SUPPLY	IT ROOM ON FC CORRIDOR	Notifier	FCPS-24S8		06/13/2025
POWER SUPPLY	IT ROOM ON FC CORRIDOR	Notifier	FCPS-24S8		06/13/2025
ELECTRICAL RM POWER SUPPLY BY G POD (1)	POWER SUPPLY	Notifier	FCPS-24S8		06/13/2025

Supervising Station Transmitting Equipment					
ADDRESS	DESCRIPTION	MANUFACTURER	MODEL	SERIAL	INSTALL DATE
Digital Alarm Communicator Transmitter					
	DIALER next to FACP	Notifier	911A		06/13/2025